

**ALTOL ENVIRONMENTAL SERVICES, INC.**

PO BOX 359 MERCEDITA, PR 00715-0359

CHAIN OF CUSTODY (TRANSMITTAL SHEET FOR AIR SAMPLES)

PAGE ____ OF ____



Customer Name: <u>Homeca Recycling and Demolition's</u>					Project Name: <u>Esc. 2 Unidad Jorge Lucas Valdivieso</u>										
Contact: <u>Norma Collazo</u>					Total Samples: <u>9</u>					Job Number: <u>ENJ-1161</u>					
Phone / Fax/Email: <u>787-373-6722</u>					Worker Name: <u>Eliceo Caraballo</u>					Worker ID: <u>ASB-1213-0505-AW</u>					
Collected By: <u>Jose A Santos</u> <u>ASB-0912-0558-MS</u>					Worker Name: <u>N/A</u>					Worker ID: <u>N/A</u>					
Analyzed By Lab: <u>Altol Chemical Environmental Laboratory, Inc.</u>					Worker Name: <u>N/A</u>					Worker ID: <u>N/A</u>					
AIHA Lab ID: <u>199763</u>					Worker Name: <u>N/A</u>					Worker ID: <u>N/A</u>					
Project Description: <u>Re Cleaning Room # 26</u>															
Lab ID	Date	Sample ID	Sample Description	Pump	Time		Flow Rate			Volume (L)	Asbestos		Lead Air	Minutes	SAMPLE TYPE
					START	STOP	Initial	Final	Avg.		PCM	TEM			
JS09061401	Jun-09-14	1161-090614-ASB-JS-01	Field Blank I	-----	----	----	----	----	----	---	X			---	FB
JS09061402	Jun-09-14	1161-090614-ASB-JS-02	Field Blank II	-----	----	----	----	----	----	---	X			---	FB
JS09061403	Jun-09-14	1161-090614-ASB-JS-03	Eliceo Caraballo, Re Cleaning Room # 26	LV-2072	7:19	7:50	1.6	1.6	1.6	49.6	X			31	E
JS09061404	Jun-09-14	1161-090614-ASB-JS-04	Eliceo Caraballo, Re Cleaning Room # 26	LV-2072	7:51	11:26	1.6	1.6	1.6	344.0	X			215	PRCE
JS09061405	Jun-09-14	1161-090614-ASB-JS-05	Eliceo Caraballo, Re Cleaning Room # 26	LV-2072	12:50	15:26	1.6	1.5	1.6	241.8	X			156	PRCE
JS09061406	Jun-09-14	1161-090614-ASB-JS-06	Inside Area	LV-2046	7:21	11:27	1.6	1.6	1.6	393.6	X			246	CE
JS09061407	Jun-09-14	1161-090614-ASB-JS-07	Inside Area	LV-2046	12:52	15:28	1.6	1.4	1.4	218.4	X			156	CE
JS09061408	Jun-09-14	1161-090614-ASB-JS-08	Outside Area (Decon)	LV-5087	7:22	11:28	2.5	2.5	2.5	615.0	X			246	OS
JS09061409	Jun-09-14	1161-090614-ASB-JS-09	Outside Area (Decon)	LV-5087	12:53	15:29	2.5	2.4	2.4	374.4	X			156	OS
Turn Around Time: Normal: 7 days <u> X </u> Rush: 24 hours <u> </u> Rush: 16 hours <u> </u>															
Sampling Collected by:		Relinquished by:		Received by:		Relinquished by:		Received by:		Delivery to Lab by:		Received at Lab by:			
Jose A Santos												Jose A Santos			
Date: <u>Jun-09-14</u> Time:		Date: <u> </u> Time:		Date: <u> </u> Time:		Date: <u> </u> Time:		Date: <u> </u> Time:		Date: <u> </u> Time:		Date: <u>Jun-09-14</u> Time:			
Lab ID	Date	Sample ID	Sample Description	Pump	Time		Flow Rate			Volume (L)	Asbestos		Lead Air	Minutes	SAMPLE TYPE
					START	STOP	Initial	Final	Avg.		PCM	TEM			



ALTOL ENVIRONMENTAL SERVICES, INC.
PO BOX 359 MERCEDITA, PR 00715-0359
FINAL DAILY PCM AIR MONITORING REPORT FOR FIELD ANALYSIS




Customer Name: Homeca Recycling and Demolition's	Project Name: Esc. 2 Unidad Jorge Lucas Valdivieso
Contact: Norma Collazo	Total Samples: 9 Job Number: ENJ-1161
Phone / Fax/Email: 787-373-6722	Custody Record #:
Sampling Date: Jun-09-14 Analytical Method: NIOSH 7400	Collected ID: ASB-0912-0558-MS
Collected By: Jose A Santos	Delivery Date: Jun-10-14
Delivery By: Jose A Santos	Received Date: Jun-10-14
Received By: Jose A Santos	AIHA Lab ID: 199763
Analyzed By: Jose A Santos Altol Chemical Environmental Laboratory, Inc.	Worker ID: ASB--1213-0505-AW
Worker Name: Eliceo Caraballo	Worker ID: N/A
Worker Name: N/A	Worker ID: N/A
Worker Name: N/A	Worker ID: N/A
Worker Name: N/A	Worker ID: N/A

Project Description: Re Cleaning Room # 26

Sample ID	Location	Type	TIME		FLOW RATE (LPM)	SAMPLE VOLUME (Liters)	TOTAL FIELDS COUNTED	TOTAL FIBERS COUNTED	FIBER DENSITY (f/mm2)	M.F.C (f/cc)	L.O.D (f/cc)	R.F.C (f/cc)	T.W.A 8hrs (f/cc)
			START	STOP									
1161-090614-ASB-JS-01	Field Blank I	FB	----	----	----	---	100	0	0.0	----	----	----	
1161-090614-ASB-JS-02	Field Blank II	FB	----	----	----	---	100	0	0.0	----	----	----	
1161-090614-ASB-JS-03	Eliceo Caraballo, Re Cleaning Room # 26	E	7:19	7:50	1.6	49.6	100	8.5	10.8	0.0840	0.0544	0.0840	< 0.0239
1161-090614-ASB-JS-04	Eliceo Caraballo, Re Cleaning Room # 26	PRCE	7:51	11:26	1.6	344.0	100	16	20.4	0.0228	0.0078	0.0228	
1161-090614-ASB-JS-05	Eliceo Caraballo, Re Cleaning Room # 26	PRCE	12:50	15:26	1.6	241.8	100	12.5	15.9	0.0254	0.0112	0.0254	
1161-090614-ASB-JS-06	Inside Area	CE	7:21	11:27	1.6	393.6	100	14	17.8	0.0174	0.0069	0.0174	<
1161-090614-ASB-JS-07	Inside Area	CE	12:52	15:28	1.6	249.6	100	13.5	17.2	0.0265	0.0108	0.0265	


MFC = Measured Fibers Concentration. LOD = Limit of Detection. RFC = Reported Fibers Concentration. T.W.A = Time Weighted Average. PR = Personal
T= Type of Sample. BG = Background. EX = Exposure. OS = Outside. PP = Preparation. RM = Removal. CE = Cleaning. CL= Clearance. E = Excursion.

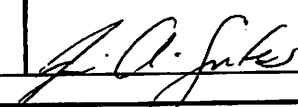Reported By: Jose A Santos Environmental Technician jose.santos@altolenterprises.com Phone: 787-507-1627	Signature: 	Verified By: Carlos Ocasio Altol Operation Manager carlos.ocasio@altolenterprises.com Phone: 787-835-4242 / 4229	Signature:
Date: Jun-09-14		Date:	



ALTOL ENVIRONMENTAL SERVICES, INC.
PO BOX 359 MERCEDITA, PR 00715-0359
FINAL DAILY PCM AIR MONITORING REPORT FOR FIELD ANALYSIS

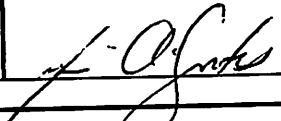

Customer Name: Homeca Recycling and Demolition's Contact: Norma Collazo Phone / Fax/Email: 787-373-6722 Sampling Date: Jun-09-14 Analytical Method: NIOSH 7400 Collected By: Jose A Santos Delivery By: Jose A Santos Received By: Jose A Santos Analyzed By: Jose A Santos Altol Chemical Environmental Laboratory, Inc. Worker Name: Eliceo Caraballo Worker Name: N/A Worker Name: N/A Worker Name: N/A								Project Name: Esc. 2 Unidad Jorge Lucas Valdivieso Total Samples: 9 Job Number: ENJ-1161 Custody Record #: Collected ID: ASB-0912-0558-MS Delivery Date: Jun-10-14 Received Date: Jun-10-14 AIHA Lab ID: 199763 Worker ID: ASB-1213-0505-AW Worker ID: N/A Worker ID: N/A Worker ID: N/A					
Project Description: Re Cleaning Room # 26													
Sample ID	Location	Type	TIME		FLOW RATE (LPM)	SAMPLE VOLUME (Liters)	TOTAL FIELDS COUNTED	TOTAL FIBERS COUNTED	FIBER DENSITY (f/mm2)	M.F.C (f/cc)	L.O.D (f/cc)	R.F.C (f/cc)	T.W.A 8hrs (f/cc)
			START	STOP									
1161-090614-ASB-JS-08	Outside Area (Decon)	OS	7:22	11:28	2.5	615.0	100	12	15.3	0.0096	0.0044	0.0096	
1161-090614-ASB-JS-09	Inside Room # 29	OS	12:53	15:29	2.5	390.0	100	10.5	13.4	0.0132	0.0069	0.0132	
MFC = Measured Fibers Concentration. LOD = Limit of Detection. RFC = Reported Fibers Concentration. T.W.A = Time Weighted Average. PR = Personal T= Type of Sample. BG = Background. EX = Exposure. OS = Outside. PP = Preparation. RM = Removal. CE = Cleaning. CL= Clearance. E = Excursion.													
Reported By: Jose A Santos Environmental Technician jose.santos@altolenterprises.com Phone: 787-507-1627			Signature: 			Verified By: Carlos Ocasio Altol Operation Manager carlos.ocasio@altolenterprises.com Phone: 787-835-4242 / 4229			Signature:				
Date: Jun-09-14						Date:							



ALTOL ENVIRONMENTAL SERVICES, INC.

PO BOX 359 MERCEDITA, PR 00715-0359
CHAIN OF CUSTODY (TRANSMITTAL SHEET FOR AIR SAMPLES)

PAGE ____ OF ____



Customer Name: <u>Homeca Recycling and Demolition's</u>	Project Name: <u>Esc. 1 Unidad Jorge Lucas Valdivieso</u>
Contact: <u>Norma Collazo</u>	Total Samples: <u>11</u> Job Number: <u>ENJ-: 1161</u>
Phone / Fax/Email: <u>787-373-6722</u>	Worker Name: <u>Emmanuel Ramos</u> Worker ID: <u>ASB-0913-0335-AW</u>
Collected By: <u>Jose A Santos</u> <u>ASB-0912-0558-MS</u>	Worker Name: <u>N/A</u> Worker ID: <u>N/A</u>
Analized By Lab: <u>Altol Chemical Environmental Laboratory, Inc.</u>	Worker Name: <u>N/A</u> Worker ID: <u>N/A</u>
AIHA Lab ID: <u>199763</u>	Worker Name: <u>N/A</u> Worker ID: <u>N/A</u>

Project Description: Cleaning , and sealling windows in rooms 24,4 , 23 y 3 .

Lab ID	Date	Sample ID	Sample Description	Pump	Time		Flow Rate			Volume (L)	Asbestos		Lead Air	Minutes
					START	STOP	Initial	Final	Avg.		PCM	TEM		
JS09061401	Jun-09-14	1161-090614-ASB-JS-01	Field Blank I	-----	----	----	----	----	----	---	X			---
JS09061402	Jun-09-14	1161-090614-ASB-JS-02	Field Blank II	-----	----	----	----	----	----	---	X			---
JS09061403	Jun-09-14	1161-090614-ASB-JS-03	Emmanuel Ramos,Cleaning and sealling windows.	LV-6124	8:02	8:32	1.6	1.6	1.6	48.0	X			30
JS09061404	Jun-09-14	1161-090614-ASB-JS-04	Emmanuel Ramos,Cleaning and sealling windows.	LV-6124	8:32	11:52	1.6	1.6	1.6	320.0	X			200
JS09061405	Jun-09-14	1161-090614-ASB-JS-05	Emmanuel Ramos,Cleaning and sealling windows.	LV-6124	13:10	16:05	1.6	1.5	1.6	271.3	X			175
JS09061406	Jun-09-14	1161-090614-ASB-JS-06	Inside Area East	LV-2019	8:04	11:54	1.6	1.6	1.6	368.0	X			230
JS09061407	Jun-09-14	1161-090614-ASB-JS-07	Inside Area East	LV-2019	13:11	16:07	1.6	1.4	1.4	246.4	X			176
JS09061408	Jun-09-14	1161-090614-ASB-JS-08	Inside Area West	LV-5093	8:06	11:55	2.5	2.5	2.5	572.5	X			229
JS09061409	Jun-09-14	1161-090614-ASB-JS-09	Inside Area West	LV-5093	13:12	16:09	2.5	2.4	2.4	424.8	X			177

Turn Around Time: Normal: 7 days X Rush: 24 hours _____ Rush: 16 hours _____

Sampling Collected by:	Relinquished by:	Received by:	Relinquished by:	Received by:	Delivery to Lab by:	Received at Lab by:
Jose A Santos						Jose A Santos
Date: Time:	Date: Time:	Date: Time:	Date: Time:	Date: Time:	Date: Time:	Date: Time:
Jun-09-14						Jun-09-14



ALTOL ENVIRONMENTAL SERVICES, INC.

PO BOX 359 MERCEDITA, PR 00715-0359
CHAIN OF CUSTODY (TRANSMITTAL SHEET FOR AIR SAMPLES)

PAGE ____ OF ____



Customer Name: <u>Homeca Recycling and Demolition's</u>	Project Name: <u>Esc. 1 Unidad Jorge Lucas Valdivieso</u>
Contact: <u>Norma Collazo</u>	Total Samples: <u>11</u> Job Number: <u>ENJ-: 1161</u>
Phone / Fax/Email: <u>787-373-6722</u>	Worker Name: <u>Emmanuel Ramos</u> Worker ID: <u>ASB-0913-0335-AW</u>
Collected By: <u>Jose A Santos</u> <u>ASB-0912-0558-MS</u>	Worker Name: <u>N/A</u> Worker ID: <u>N/A</u>
Analized By Lab: <u>Altol Chemical Environmental Laboratory, Inc.</u>	Worker Name: <u>N/A</u> Worker ID: <u>N/A</u>
AIHA Lab ID: <u>199763</u>	Worker Name: <u>N/A</u> Worker ID: <u>N/A</u>

Project Description: Cleaning , and sealling windows in rooms 24,4 , 23 y 3 .


Lab ID	Date	Sample ID	Sample Description	Pump	Time		Flow Rate			Volume (L)	Asbestos		Lead Air	Minutes
					START	STOP	Initial	Final	Avg.		PCM	TEM		
JS09061410	Jun-09-14	1161-090614-ASB-JS-10	Outside Area (Decon)	LV-1066	8:10	11:58	2.5	2.5	2.5	570.0	X			228
JS09061411	Jun-09-14	1161-090614-ASB-JS-11	Outside Area (Decon)	LV-1066	13:13	16:14	2.5	2.3	2.3	416.3	X			181

Turn Around Time: Normal: 7 days <u> X </u>		Rush: 24 hours <u> </u>		Rush: 16 hours <u> </u>		
Sampling Collected by:	Relinquished by:	Received by:	Relinquished by:	Received by:	Delivery to Lab by:	Received at Lab by:
Jose A Santos						Jose A Santos
Date: Time:	Date: Time:	Date: Time:	Date: Time:	Date: Time:	Date: Time:	Date: Time:
Jun-09-14						Jun-09-14



ALTOL ENVIRONMENTAL SERVICES, INC.
PO BOX 359 MERCEDITA, PR 00715-0359
FINAL DAILY PCM AIR MONITORING REPORT FOR FIELD ANALYSIS

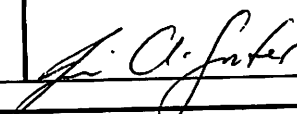


Customer Name: Homeca Recycling and Demolition's Contact: Norma Collazo Phone / Fax/Email: 787-373-6722 Sampling Date: Jun-09-14 Analytical Method: NIOSH 7400 Collected By: Jose A Santos Delivery By: Jose A Santos Received By: Jose A Santos Analyzed By: Jose A Santos Altol Chemical Environmental Laboratory, Inc. Worker Name: Emmanuel Ramos Worker Name: N/A Worker Name: N/A Worker Name: N/A							Project Name: Esc. 1 Unidad Jorge Lucas Valdivieso Total Samples: 11 Job Number: ENJ-1161 Custody Record #: Collected ID: ASB-0912-0558-MS Delivery Date: Jun-10-14 Received Date: Jun-10-14 AIHA Lab ID: 199763 Worker ID: ASB-0913-0335-AW Worker ID: N/A Worker ID: N/A Worker ID: N/A						
Project Description: Cleaning , and sealling windows in rooms 24,4 , 23 y 3 .													
Sample ID	Location	Type	TIME		FLOW RATE (LPM)	SAMPLE VOLUME (Liters)	TOTAL FIELDS COUNTED	TOTAL FIBERS COUNTED	FIBER DENSITY (f/mm2)	M.F.C (f/cc)	L.O.D (f/cc)	R.F.C (f/cc)	T.W.A 8hrs (f/cc)
			START	STOP									
1161-090614-ASB-JS-01	Field Blank I	FB	----	----	----	---	100	0	0.0	----	----	----	
1161-090614-ASB-JS-02	Field Blank II	FB	----	----	----	---	100	0	0.0	----	----	----	
1161-090614-ASB-JS-03	Emmanuel Ramos,Cleaning and sealling windows.	E	8:02	8:32	1.6	48.0	100	21.5	27.4	0.2197	0.0562	0.2197	< 0.0517
1161-090614-ASB-JS-04	Emmanuel Ramos,Cleaning and sealling windows.	PRCE	8:32	11:52	1.6	320.0	100	27	34.4	0.0414	0.0084	0.0414	
1161-090614-ASB-JS-05	Emmanuel Ramos,Cleaning and sealling windows.	PRCE	13:10	16:05	1.6	271.3	100	31.5	40.1	0.0570	0.0100	0.0570	
1161-090614-ASB-JS-06	Inside Area East	CE	8:04	11:54	1.6	368.0	100	32	40.8	0.0426	0.0073	0.0426	<
1161-090614-ASB-JS-07	Inside Area East	CE	13:11	16:07	1.6	281.6	100	26.5	33.8	0.0462	0.0096	0.0462	
MFC = Measured Fibers Concentration. LOD = Limit of Detection. RFC = Reported Fibers Concentration. T.W.A = Time Weighted Average. PR = Personal T= Type of Sample. BG = Background. EX = Exposure. OS = Outside. PP = Preparation. RM = Removal. CE = Cleaning. CL= Clearance. E = Excursion.													
Reported By: Jose A Santos Environmental Technician jose.santos@altolenterprises.com Phone: 787-507-1627			Signature: 			Verified By: Carlos Ocasio Altol Operation Manager carlos.ocasio@altolenterprises.com Phone: 787-835-4242 / 4229			Signature:				
Date: Jun-09-14						Date:							



ALTOL ENVIRONMENTAL SERVICES, INC.
PO BOX 359 MERCEDITA, PR 00715-0359
FINAL DAILY PCM AIR MONITORING REPORT FOR FIELD ANALYSIS

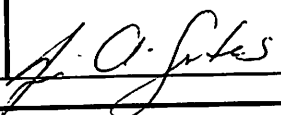

Customer Name: Homeca Recycling and Demolition's Contact: Norma Collazo Phone / Fax/Email: 787-373-6722 Sampling Date: Jun-09-14 Analytical Method: NIOSH 7400 Collected By: Jose A Santos Delivery By: Jose A Santos Received By: Jose A Santos Analyzed By: Jose A Santos Altol Chemical Environmental Laboratory, Inc. Worker Name: Emmanuel Ramos Worker Name: N/A Worker Name: N/A Worker Name: N/A						Project Name: Esc. 1 Unidad Jorge Lucas Valdivieso Total Samples: 11 Job Number: ENJ-1161 Custody Record #: Collected ID: ASB-0912-0558-MS Delivery Date: Jun-10-14 Received Date: Jun-10-14 AIHA Lab ID: 199763 Worker ID: ASB-0913-0335-AW Worker ID: N/A Worker ID: N/A Worker ID: N/A							
Project Description: Cleaning , and sealling windows in rooms 24,4 , 23 y 3 .													
Sample ID	Location	Type	TIME		FLOW RATE (LPM)	SAMPLE VOLUME (Liters)	TOTAL FIELDS COUNTED	TOTAL FIBERS COUNTED	FIBER DENSITY (f/mm2)	M.F.C (f/cc)	L.O.D (f/cc)	R.F.C (f/cc)	T.W.A 8hrs (f/cc)
			START	STOP									
1161-090614-ASB-JS-08	Inside Area West	CE	8:06	11:55	2.5	572.5	100	27	34.4	0.0231	0.0047	0.0231	
1161-090614-ASB-JS-09	Inside Room # 29	CE	13:12	16:09	2.5	442.5	100	24.5	31.2	0.0272	0.0061	0.0272	
1161-090614-ASB-JS-10	Outside Area (Decon)	OS	8:10	11:58	2.5	570.0	100	7	8.9	0.0060	0.0047	0.0060	
1161-090614-ASB-JS-11	Outside Area (Decon)	OS	13:13	16:14	2.5	452.5	100	8	10.2	0.0087	0.0060	0.0087	
MFC = Measured Fibers Concentration. LOD = Limit of Detection. RFC = Reported Fibers Concentration. T.W.A = Time Weighted Average. PR = Personal T= Type of Sample. BG = Background. EX = Exposure. OS = Outside. PP = Preparation. RM = Removal. CE = Cleaning. CL= Clearance. E = Excursion.													
Reported By: Jose A Santos Environmental Technician jose.santos@altolenterprises.com Phone: 787-507-1627			Signature: 			Verified By: Carlos Ocasio Altol Operation Manager carlos.ocasio@altolenterprises.com Phone: 787-835-4242 / 4229			Signature:				
Date: Jun-09-14						Date:							



ALTOL ENVIRONMENTAL SERVICES, INC.

PO BOX 359 MERCEDITA, PR 00715-0359

CHAIN OF CUSTODY (TRANSMITTAL SHEET FOR AIR SAMPLES)

PAGE ____ OF ____



Customer Name: Homeca Recycling and Demolition's	Project Name: Esc. 1 Unidad Jorge Lucas Valdivieso
Contact: Norma Collazo	Total Samples: 13 Job Number: ENJ 1161
Phone / Fax/Email: 787-373-6722	Worker Name: Felix Valentin Worker ID: ASB-1013-0415-AW
Collected By: Jose A Santos ASB-0912-0558-MS	Worker Name: Jose E Delgado Worker ID: ASB-0913-0333-AW
Analyzed By Lab: Altol Chemical Environmental Laboratory, Inc.	Worker Name: N/A Worker ID: N/A
AIHA Lab ID: 199763	Worker Name: N/A Worker ID: N/A

Project Description: Cleaning , rooms 4, 24 , 23 y 3 .

Lab ID	Date	Sample ID	Sample Description	Pump	Time		Flow Rate			Volume (L)	Asbestos		Lead Air	Minutes	SAMPLE TYPE
					START	STOP	Initial	Final	Avg.		PCM	TEM			
JS10061401	Jun-10-14	1161-100614-ASB-JS-01	Field Blank I	-----	----	----	----	----	----	---	X			---	FB
JS10061402	Jun-10-14	1161-100614-ASB-JS-02	Field Blank II	-----	----	----	----	----	----	---	X			---	FB
JS10061403	Jun-10-14	1161-100614-ASB-JS-03	Felix Valentin ,Cleaning Rooms	LV-6124	8:00	8:32	1.6	1.6	1.6	51.2	X			32	E
JS10061404	Jun-10-14	1161-100614-ASB-JS-04	Felix Valentin ,Cleaning Rooms	LV-6124	8:34	12:00	1.6	1.6	1.6	329.6	X			206	PRCE
JS10061405	Jun-10-14	1161-100614-ASB-JS-05	Felix Valentin ,Cleaning Rooms	LV-6124	13:15	15:36	1.6	1.5	1.6	218.6	X			141	PRCE
JS10061406	Jun-10-14	1161-100614-ASB-JS-06	Jose E Delgado, Cleaning Rooms	LV-2019	8:04	12:01	1.6	1.6	1.6	379.2	X			237	PRCE
JS10061407	Jun-10-14	1161-100614-ASB-JS-07	Jose E Delgado, Cleaning Rooms	LV-2019	13:16	15:38	1.6	1.4	1.4	198.8	X			142	PRCE
JS10061408	Jun-10-14	1161-100614-ASB-JS-08	Inside Area (West)	LV-2022	8:05	12:02	2.5	2.5	2.5	592.5	X			237	CE
JS10061409	Jun-10-14	1161-100614-ASB-JS-09	Inside Area (West)	LV-2022	13:18	15:39	2.5	2.4	2.4	338.4	X			141	CE

Turn Around Time: Normal: 7 days X Rush: 24 hours Rush: 16 hours

Sampling Collected by:	Relinquished by:	Received by:	Relinquished by:	Received by:	Delivery to Lab by:	Received at Lab by:
Jose A Santos						Jose A Santos
Date: Time:	Date: Time:	Date: Time:	Date: Time:	Date: Time:	Date: Time:	Date: Time:
Jun-10-14						Jun-10-14

Lab ID	Date	Sample ID	Sample Description	Pump	Time		Flow Rate			Volume (L)	Asbestos		Lead Air	Minutes	SAMPLE TYPE
					START	STOP	Initial	Final	Avg.		PCM	TEM			

**ALTOL ENVIRONMENTAL SERVICES, INC.**

PO BOX 359 MERCEDITA, PR 00715-0359

CHAIN OF CUSTODY (TRANSMITTAL SHEET FOR AIR SAMPLES)

PAGE ____ OF ____



Customer Name: Homeca Recycling and Demolition's	Project Name: Esc. 1 Unidad Jorge Lucas Valdivieso
Contact: Norma Collazo	Total Samples: 13 Job Number: ENJ 1161
Phone / Fax/Email: 787-373-6722	Worker Name: Felix Valentin Worker ID: ASB-1013-0415-AW
Collected By: Jose A Santos ASB-0912-0558-MS	Worker Name: Jose E Delgado Worker ID: ASB-0913-0333-AW
Analized By Lab: Altol Chemical Environmental Laboratory, Inc.	Worker Name: N/A Worker ID: N/A
AIHA Lab ID: 199763	Worker Name: N/A Worker ID: N/A

Project Description: Cleaning , rooms 4, 24 , 23 y 3 .


JS10061410	Jun-10-14	1161-100614-ASB-JS-10	Inside Area (East)	LV-1066	8:08	12:03	2.5	2.5	2.5	587.5	X			235	CE
JS10061411	Jun-10-14	1161-100614-ASB-JS-11	Inside Area (East)	LV-1066	13:19	15:40	2.5	2.3	2.3	324.3	X			141	CE
JS10061412	Jun-10-14	1161-100614-ASB-JS-12	Outside (Decon)	LV-5093	8:09	12:04	2.5	2.5	2.5	587.5	X			235	OS
JS10061413	Jun-10-14	1161-100614-ASB-JS-13	Outside (Decon)	LV-5093	13:20	15:41	2.5	2.4	2.4	338.4	X			141	OS

Turn Around Time: Normal: 7 days <u> X </u>				Rush: 24 hours <u> </u>				Rush: 16 hours <u> </u>			
Sampling Collected by:	Relinquished by:	Received by:	Relinquished by:	Received by:	Delivery to Lab by:	Received at Lab by:					
Jose A Santos						Jose A Santos					
Date: Time:	Date: Time:	Date: Time:	Date: Time:	Date: Time:	Date: Time:	Date: Time:					
Jun-10-14						Jun-10-14					



ALTOL ENVIRONMENTAL SERVICES, INC.
PO BOX 359 MERCEDITA, PR 00715-0359
FINAL DAILY PCM AIR MONITORING REPORT FOR FIELD ANALYSIS

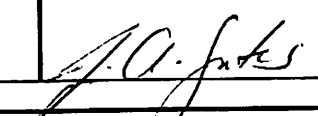

Customer Name: Homeca Recycling and Demolition's						Project Name: Esc. 1 Unidad Jorge Lucas Valdivieso							
Contact: Norma Collazo						Total Samples: 13 Job Number: ENJ-1161							
Phone / Fax/Email: 787-373-6722						Custody Record #:							
Sampling Date: Jun-10-14 Analytical Method: NIOSH 7400						Collected ID: ASB-0912-0558-MS							
Collected By: Jose A Santos						Delivery Date: Jun-11-14							
Delivery By: Jose A Santos						Received Date: Jun-11-14							
Received By: Jose A Santos						AIHA Lab ID: 199763							
Analyzed By: Jose A Santos Altol Chemical Environmental Laboratory, Inc.						Worker ID: ASB-1013-0415-AW							
Worker Name: Felix Valentin						Worker ID: ASB-0913-0333-AW							
Worker Name: Jose E Delgado						Worker ID: N/A							
Worker Name: N/A						Worker ID: N/A							
Worker Name: N/A													
Project Description: Cleaning , rooms 4, 24 , 23 y 3 .													
Sample ID	Location	Type	TIME		FLOW RATE (LPM)	SAMPLE VOLUME (Liters)	TOTAL FIELDS COUNTED	TOTAL FIBERS COUNTED	FIBER DENSITY (f/mm2)	M.F.C (f/cc)	L.O.D (f/cc)	R.F.C (f/cc)	T.W.A 8hrs (f/cc)
			START	STOP									
1161-100614-ASB-JS-01	Field Blank I	FB	----	----	----	---	100	0	0.0	----	----	----	
1161-100614-ASB-JS-02	Field Blank II	FB	----	----	----	---	100	0	0.0	----	----	----	
1161-100614-ASB-JS-03	Felix Valentin ,Cleaning Rooms	E	8:00	8:32	1.6	51.2	100	11.5	14.6	0.1102	0.0527	0.1102	< 0.0368
1161-100614-ASB-JS-04	Felix Valentin ,Cleaning Rooms	PRCE	8:34	12:00	1.6	329.6	100	25	31.8	0.0372	0.0082	0.0372	
1161-100614-ASB-JS-05	Felix Valentin ,Cleaning Rooms	PRCE	13:15	15:36	1.6	218.6	100	20.5	26.1	0.0460	0.0124	0.0460	
1161-100614-ASB-JS-06	Jose E Delgado, Cleaning Rooms	PRCE	8:04	12:01	1.6	379.2	100	30.5	38.9	0.0394	0.0071	0.0394	< 0.0310
1161-100614-ASB-JS-07	Jose E Delgado, Cleaning Rooms	PRCE	13:16	15:38	1.6	227.2	100	18	22.9	0.0389	0.0119	0.0389	
MFC = Measured Fibers Concentration. LOD = Limit of Detection. RFC = Reported Fibers Concentration. T.W.A = Time Weighted Average. PR = Personal T= Type of Sample. BG = Background. EX = Exposure. OS = Outside. PP = Preparation. RM = Removal. CE = Cleaning. CL= Clearance. E = Excursion.													
Reported By: Jose A Santos Environmental Technician jose.santos@altolenterprises.com Phone: 787-507-1627		Signature: 		Verified By: Carlos Ocasio Altol Operation Manager carlos.ocasio@altolenterprises.com Phone: 787-835-4242 / 4229		Signature:							
Date: Jun-10-14				Date:									



ALTOL ENVIRONMENTAL SERVICES, INC.
PO BOX 359 MERCEDITA, PR 00715-0359
FINAL DAILY PCM AIR MONITORING REPORT FOR FIELD ANALYSIS




Customer Name: Homeca Recycling and Demolition's	Project Name: Esc. 1 Unidad Jorge Lucas Valdivieso
Contact: Norma Collazo	Total Samples: 13 Job Number: ENJ-1161
Phone / Fax/Email: 787-373-6722	Custody Record #:
Sampling Date: Jun-10-14 Analytical Method: NIOSH 7400	Collected ID: ASB-0912-0558-MS
Collected By: Jose A Santos	Delivery Date: Jun-11-14
Delivery By: Jose A Santos	Received Date: Jun-11-14
Received By: Jose A Santos	AIHA Lab ID: 199763
Analyzed By: Jose A Santos Altol Chemical Environmental Laboratory, Inc.	Worker ID: ASB-1013-0415-AW
Worker Name: Felix Valentin	Worker ID: ASB-0913-0333-AW
Worker Name: Jose E Delgado	Worker ID: N/A
Worker Name: N/A	Worker ID: N/A
Worker Name: N/A	

Project Description: Cleaning , rooms 4, 24 , 23 y 3 .

Sample ID	Location	Type	TIME		FLOW RATE (LPM)	SAMPLE VOLUME (Liters)	TOTAL FIELDS COUNTED	TOTAL FIBERS COUNTED	FIBER DENSITY (f/mm2)	M.F.C (f/cc)	L.O.D (f/cc)	R.F.C (f/cc)	T.W.A 8hrs (f/cc)
			START	STOP									
1161-100614-ASB-JS-08	Inside Area (West)	CE	8:06	12:02	2.5	590.0	100	19	24.2	0.0158	0.0046	0.0158	
1161-100614-ASB-JS-09	Inside Area (West)	CE	13:18	15:39	2.5	352.5	100	23	29.3	0.0320	0.0077	0.0320	
1161-100614-ASB-JS-10	Inside Area (East)	CE	8:08	12:03	2.5	587.5	100	30.5	38.9	0.0255	0.0046	0.0255	
1161-100614-ASB-JS-11	Inside Area (East)	CE	13:19	15:40	2.5	352.5	100	26.5	33.8	0.0369	0.0077	0.0369	
1161-100614-ASB-JS-12	Outside (Decon)	OS	8:09	12:04	2.5	587.5	100	8.5	10.8	0.0071	0.0046	0.0071	
1161-100614-ASB-JS-13	Outside (Decon)	OS	13:20	15:41	2.5	352.5	100	12.5	15.9	0.0174	0.0077	0.0174	

MFC = Measured Fibers Concentration. LOD = Limit of Detection. RFC = Reported Fibers Concentration. T.W.A = Time Weighted Average. PR = Personal T= Type of Sample. BG = Background. EX = Exposure. OS = Outside. PP = Preparation. RM = Removal. CE = Cleaning. CL= Clearance. E = Excursion.

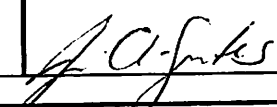Reported By: Jose A Santos Environmental Technician jose.santos@altolenterprises.com Phone: 787-507-1627	Signature: 	Verified By: Carlos Ocasio Altol Operation Manager carlos.ocasio@altolenterprises.com Phone: 787-835-4242 / 4229	Signature:
Date: Jun-10-14		Date:	

Customer Name: <u>Homeca Recycling and Demolition's</u> Contact: <u>Norma Collazo</u> Phone / Fax/Email: <u>787-373-6722</u> Collected By: <u>Jose A Santos</u> <u>ASB-0912-0558-MS</u> Analized By Lab: <u>Altol Chemical Environmental Laboratory, Inc.</u> AIHA Lab ID: <u>199763</u>	Project Name: <u>Antigua P,R, Olefins, Peñuelas P.R.</u> Total Samples: <u>14</u> Job Number: <u>ENJ- 341</u> Worker Name: <u>Fernando Carrelo</u> Worker ID: <u>ASB-0314-0105-AW</u> Worker Name: <u>N/A</u> Worker ID: <u>N/A</u> Worker Name: <u>N/A</u> Worker ID: <u>N/A</u> Worker Name: <u>N/A</u> Worker ID: <u>N/A</u>
---	---

Project Description: Wetting the contaminated area, to control fugitive dust in the air . And, Air Monitoring Outside the resticted area according to cardinals points.

Lab ID	Date	Sample ID	Sample Description	Pump	Time		Flow Rate			Volume (L)	Asbestos		Lead Air	Minutes	SAMPLE TYPE
					START	STOP	Initial	Final	Avg.		PCM	TEM			
JS11061401	Jun-11-14	341-110614-ASB-JS-01	Field Blank I	-----	----	----	----	----	----	---	X			---	FB
JS11061402	Jun-11-14	341-110614-ASB-JS-02	Field Blank II	-----	----	----	----	----	----	---	X			---	FB
JS11061403	Jun-11-14	341-110614-ASB-JS-03	Fernando Carrelo, Weeting the Area .	LV-2019	10:16	10:46	1.6	1.6	1.6	48.0	X			30	E
JS11061404	Jun-11-14	341-110614-ASB-JS-04	Fernando Carrelo, Weeting the Area .	LV-2019	10:46	11:14	1.6	1.6	1.6	44.8	X			28	PREX
JS11061405	Jun-11-14	341-110614-ASB-JS-05	Inside Area	LV-2072	10:19	11:12	2.5	2.5	2.5	132.5	X			53	EX
JS11061406	Jun-11-14	341-110614-ASB-JS-06	Outside Area (Decon)	LV-1059	10:20	11:15	2.5	2.5	2.5	137.5	X			55	OS
JS11061407	Jun-11-14	341-110614-ASB-JS-07	Outside Area (North)	LV-5089	8:10	11:32	2.5	2.5	2.5	505.0	X			202	OS
JS11061408	Jun-11-14	341-110614-ASB-JS-08	Outside Area (North)	LV-5089	12:36	15:23	2.5	2.3	2.3	384.1	X			167	OS
JS11061409	Jun-11-14	341-110614-ASB-JS-09	Outside Area (West)	LV-6124	8:13	11:35	2.5	2.5	2.5	505.0	X			202	OS

Turn Around Time: Normal: 7 days <u> X </u> Rush: 24 hours <u> </u> Rush: 16 hours <u> </u>						
Sampling Collected by:	Relinquished by:	Received by:	Relinquished by:	Received by:	Delivery to Lab by:	Received at Lab by:
Jose A Santos						Jose A Santos
Date: Time:	Date: Time:	Date: Time:	Date: Time:	Date: Time:	Date: Time:	Date: Time:
Jun-11-14						Jun-11-14



PO BOX 359 MERCEDITA, PR 00715-0359
CHAIN OF CUSTODY (TRANSMITTAL SHEET FOR AIR SAMPLES)



Customer Name: Homeca Recycling and Demolition's

Contact: Norma Collazo

Phone / Fax/Email: 787-373-6722

Collected By: Jose A Santos ASB-0912-0558-MS

Analyzed By Lab: Altol Chemical Environmental Laboratory, Inc.

AIHA Lab ID: 199763

Project Name: Antigua P,R, Olefins, Peñuelas P.R.

Total Samples: 14 Job Number: ENJ- 341

Worker Name: Fernando Carrelo Worker ID: ASB-0314-0105-AW

Worker Name: N/A Worker ID: N/A

Worker Name: N/A Worker ID: N/A

Worker Name: N/A Worker ID: N/A

Project Description: Wetting the contaminated area, to control fugitive dust in the air . And, Air Monitoring Outside the resticted area according to cardinals points.

Lab ID	Date	Sample ID	Sample Description	Pump	Time		Flow Rate			Volume (L)	Asbestos		Lead Air	Minutes	SAMPLE TYPE
					START	STOP	Initial	Final	Avg.		PCM	TEM			
JS11061410	Jun-11-14	341-110614-ASB-JS-10	Outside Area (West)	LV-6124	12:38	15:25	2.5	2.4	2.4	400.8	X			167	OS
JS11061411	Jun-11-14	341-110614-ASB-JS-11	Outside Area (South)	LV-1056	8:14	11:36	2.5	2.5	2.5	505.0	X			202	OS
JS11061412	Jun-11-14	341-110614-ASB-JS-12	Outside Area (South)	LV-1056	12:39	15:26	2.5	2.2	2.2	367.4	X			167	OS
JS11061413	Jun-11-14	341-110614-ASB-JS-13	Outside Area (East)	LV-2022	8:16	11:38	2.5	2.5	2.5	505.0	X			202	OS
JS11061414	Jun-11-14	341-110614-ASB-JS-14	Outside Area (East)	LV-2022	12:41	15:27	2.5	2.0	2.0	332.0	X			166	OS


Turn Around Time: Normal: 7 days X Rush: 24 hours Rush: 16 hours

Sampling Collected by:	Relinquished by:	Received by:	Relinquished by:	Received by:	Delivery to Lab by:	Received at Lab by:
Jose A Santos						Jose A Santos
Date: Time:	Date: Time:	Date: Time:	Date: Time:	Date: Time:	Date: Time:	Date: Time:
Jun-11-14						Jun-11-14



ALTOL ENVIRONMENTAL SERVICES, INC.
PO BOX 359 MERCEDITA, PR 00715-0359
FINAL DAILY PCM AIR MONITORING REPORT FOR FIELD ANALYSIS

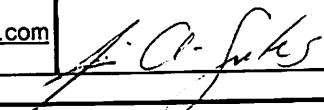

Customer Name: Homeca Recycling and Demolition's Contact: Norma Collazo Phone / Fax/Email: 787-373-6722 Sampling Date: Jun-11-14 Analytical Method: NIOSH 7400 Collected By: Jose A Santos Delivery By: Jose A Santos Received By: Jose A Santos Analyzed By: Jose A Santos Altol Chemical Environmental Laboratory, Inc. Worker Name: Fernando Carrelo Worker Name: N/A Worker Name: N/A Worker Name: N/A							Project Name: Antigua P,R, Olefins, Peñuelas P.R. Total Samples: 14 Job Number: ENJ-341 Custody Record #: Collected ID: ASB-0912-0558-MS Delivery Date: Jun-12-14 Received Date: Jun-12-14 AIHA Lab ID: 199763 Worker ID: ASB-0314-0105-AW Worker ID: N/A Worker ID: N/A Worker ID: N/A						
Project Description: Wetting the contaminated area, to control fugitive dust in the air . And, Air Monitoring Outside the resticted area according to cardinals points.													
Sample ID	Location	Type	TIME		FLOW RATE (LPM)	SAMPLE VOLUME (Liters)	TOTAL FIELDS COUNTED	TOTAL FIBERS COUNTED	FIBER DENSITY (f/mm2)	M.F.C (f/cc)	L.O.D (f/cc)	R.F.C (f/cc)	T.W.A 8hrs (f/cc)
			START	STOP									
341-110614-ASB-JS-01	Field Blank I	FB	----	----	----	---	100	0	0.0	----	----	----	
341-110614-ASB-JS-02	Field Blank II	FB	----	----	----	---	100	0	0.0	----	----	----	
341-110614-ASB-JS-03	Fernando Carrelo, Weeting the Area .	E	10:16	10:46	1.6	48.0	100	26.5	33.8	0.2708	0.0563	0.2708	< 0.0865
341-110614-ASB-JS-04	Fernando Carrelo, Weeting the Area .	PREX	10:46	11:14	1.6	44.8	100	62.5	79.6	0.6842	0.0603	0.6842	
341-110614-ASB-JS-05	Inside Area	EX	10:19	11:12	2.5	132.5	100	72.5	92.4	0.2684	0.0204	0.2684	
341-110614-ASB-JS-06	Outside Area (Decon)	OS	10:20	11:15	2.5	137.5	100	21.5	27.4	0.0767	0.0196	0.0767	<
341-110614-ASB-JS-07	Outside Area (North)	OS	8:10	11:32	2.5	505.0	100	67	85.3	0.0651	0.0053	0.0651	
MFC = Measured Fibers Concentration. LOD = Limit of Detection. RFC = Reported Fibers Concentration. T.W.A = Time Weighted Average. PR = Personal T= Type of Sample. BG = Background. EX = Exposure. OS = Outside. PP = Preparation. RM = Removal. CE = Cleaning. CL= Clearance. E = Excursion.													
Reported By: Jose A Santos Environmental Technician jose.santos@altolenterprises.com Phone: 787-507-1627		Signature: 		Verified By: Carlos Ocasio Altol Operation Manager carlos.ocasio@altolenterprises.com Phone: 787-835-4242 / 4229		Signature:							
Date: Jun-11-14				Date:									



ALTOL ENVIRONMENTAL SERVICES, INC.
PO BOX 359 MERCEDITA, PR 00715-0359
FINAL DAILY PCM AIR MONITORING REPORT FOR FIELD ANALYSIS



Customer Name: Homeca Recycling and Demolition's						Project Name: Antigua P.R, Olefins, Peñuelas P.R.							
Contact: Norma Collazo						Total Samples: 14 Job Number: ENJ-341							
Phone / Fax/Email: 787-373-6722						Custody Record #:							
Sampling Date: Jun-11-14 Analytical Method: NIOSH 7400						Collected ID: ASB-0912-0558-MS							
Collected By: Jose A Santos						Delivery Date: Jun-12-14							
Delivery By: Jose A Santos						Received Date: Jun-12-14							
Received By: Jose A Santos						AIHA Lab ID: 199763							
Analyzed By: Jose A Santos Altol Chemical Environmental Laboratory, Inc.						Worker ID: ASB-0314-0105-AW							
Worker Name: Fernando Carrelo						Worker ID: N/A							
Worker Name: N/A						Worker ID: N/A							
Worker Name: N/A						Worker ID: N/A							
Worker Name: N/A						Worker ID: N/A							

Project Description: Wetting the contaminated area, to control fugitive dust in the air . And, Air Monitoring Outside the resticted area according to cardinals points.

Sample ID	Location	Type	TIME		FLOW RATE (LPM)	SAMPLE VOLUME (Liters)	TOTAL FIELDS COUNTED	TOTAL FIBERS COUNTED	FIBER DENSITY (f/mm2)	M.F.C (f/cc)	L.O.D (f/cc)	R.F.C (f/cc)	T.W.A 8hrs (f/cc)
			START	STOP									
341-110614-ASB-JS-08	Outside Area (North)	OS	12:36	15:23	2.3	384.1	100	58.5	74.5	0.0747	0.0070	0.0747	
341-110614-ASB-JS-09	Outside Area (North)	OS	8:13	11:35	2.5	505.0	100	43	54.8	0.0418	0.0053	0.0418	
341-110614-ASB-JS-10	Outside Area (West)	OS	12:38	15:25	2.4	400.8	100	37.5	47.8	0.0459	0.0067	0.0459	
341-110614-ASB-JS-11	Outside Area (South)	OS	8:14	11:36	2.5	505.0	100	49.5	63.1	0.0481	0.0053	0.0481	
341-110614-ASB-JS-12	Outside Area (South)	OS	12:39	15:26	2.2	367.4	100	36.5	46.5	0.0487	0.0073	0.0487	
341-110614-ASB-JS-13	Outside Area (East)	OS	8:16	11:38	2.5	505.0	100	58.5	74.5	0.0568	0.0053	0.0568	
341-110614-ASB-JS-14	Outside Area (East)	OS	12:41	15:27	2.0	332.0	100	46.5	59.2	0.0687	0.0081	0.0687	

MFC = Measured Fibers Concentration. LOD = Limit of Detection. RFC = Reported Fibers Concentration. T.W.A = Time Weighted Average. PR = Personal T= Type of Sample. BG = Background. EX = Exposure. OS = Outside. PP = Preparation. RM = Removal. CE = Cleaning. CL= Clearance. E = Excursion.

Reported By: Jose A Santos Environmental Technician jose.santos@altolenterprises.com Phone: 787-507-1627	Signature: 	Verified By: Carlos Ocasio Altol Operation Manager carlos.ocasio@altolenterprises.com Phone: 787-835-4242 / 4229	Signature:
Date: Jun-11-14		Date:	



ALTOL ENVIRONMENTAL SERVICES, INC.

PO BOX 359 MERCEDITA, PR 00715-0359
CHAIN OF CUSTODY (TRANSMITTAL SHEET FOR AIR SAMPLES)

PAGE ____ OF ____



Customer Name: Homeca Recycling and Demolition's	Project Name: Esc. 1 Unidad Jorge Lucas Valdivieso
Contact: Norma Collazo	Total Samples: 13 Job Number: ENJ. 1161
Phone / Fax/Email: 787-373-6722	Worker Name: Hector Montañez Worker ID: ASB-1013-0416-AW
Collected By: Jose A Santos ASB-0912-0558-MS	Worker Name: Jose E Santiago Worker ID: ASB-0913-0335-AW
Analized By Lab: Altol Chemical Environmental Laboratory, Inc.	Worker Name: N/A Worker ID: N/A
AIHA Lab ID: 199763	Worker Name: N/A Worker ID: N/A
Project Description: Cleaning , rooms 4, 24 , 23 y 3 .	

Lab ID	Date	Sample ID	Sample Description	Pump	Time		Flow Rate			Volume (L)	Asbestos		Lead Air	Minutes	SAMPLE TYPE
					START	STOP	Initial	Final	Avg.		PCM	TEM			
JS13061401	Jun-13-14	1161-130614-ASB-JS-01	Field Blank I	-----	----	----	----	----	----	---	X			---	FB
JS13061402	Jun-13-14	1161-130614-ASB-JS-02	Field Blank II	-----		----	----	----	----	---	X			---	FB
JS13061403	Jun-13-14	1161-130614-ASB-JS-03	Hector Montañez,Cleaning Rooms	LV-2027	7:26	7:56	1.6	1.6	1.6	48.0	X			30	E
JS13061404	Jun-13-14	1161-130614-ASB-JS-04	Hector Montañez,Cleaning Rooms	LV-2027	7:56	12:00	1.6	1.6	1.6	390.4	X			244	PRCE
JS13061405	Jun-13-14	1161-130614-ASB-JS-05	Hector Montañez,Cleaning Rooms	LV-2027	13:20	15:57	1.6	1.5	1.6	243.4	X			157	PRCE
JS13061406	Jun-13-14	1161-130614-ASB-JS-06	Jose E Santiago, Cleaning Rooms	LV-2072	7:27	12:02	1.6	1.6	1.6	440.0	X			275	PRCE
JS13061407	Jun-13-14	1161-130614-ASB-JS-07	Jose E Santiago, Cleaning Rooms	LV-2072	13:21	15:58	1.6	1.5	1.5	235.5	X			157	PRCE
JS13061408	Jun-13-14	1161-130614-ASB-JS-08	Inside Area (West)	LV-6124	7:28	12:03	2.5	2.5	2.5	687.5	X			275	CE
JS13061409	Jun-13-14	1161-130614-ASB-JS-09	Inside Area (West)	LV-6124	13:22	15:59	2.5	2.3	2.3	361.1	X			157	CE

Turn Around Time: Normal: 7 days <u> X </u>		Rush: 24 hours <u> </u>		Rush: 16 hours <u> </u>		
Sampling Collected by:	Relinquished by:	Received by:	Relinquished by:	Received by:	Delivery to Lab by:	Received at Lab by:
Jose A Santos						Jose A Santos
Date: Time:	Date: Time:	Date: Time:	Date: Time:	Date: Time:	Date: Time:	Date: Time:
Jun-13-14						Jun-13-14

Customer Name: <u>Homeca Recycling and Demolition's</u> Contact: <u>Norma Collazo</u> Phone / Fax/Email: <u>787-373-6722</u> Collected By: <u>Jose A Santos</u> <u>ASB-0912-0558-MS</u> Analized By Lab: <u>Altol Chemical Environmental Laboratory, Inc.</u> AIHA Lab ID: <u>199763</u>	Project Name: <u>Esc. 1 Unidad Jorge Lucas Valdivieso</u> Total Samples: <u>13</u> Job Number: <u>ENJ- 1161</u> Worker Name: <u>Hector Montañez</u> Worker ID: <u>ASB-1013-0416-AW</u> Worker Name: <u>Jose E Santiago</u> Worker ID: <u>ASB-0913-0335-AW</u> Worker Name: <u>N/A</u> Worker ID: <u>N/A</u> Worker Name: <u>N/A</u> Worker ID: <u>N/A</u>
---	---

Project Description: Cleaning , rooms 4, 24 , 23 y 3 .

Lab ID	Date	Sample ID	Sample Description	Pump	Time		Flow Rate			Volume (L)	Asbestos		Lead Air	Minutes	SAMPLE TYPE
					START	STOP	Initial	Final	Avg.		PCM	TEM			
JS13061410	Jun-13-14	1161-130614-ASB-JS-10	Inside Area (East)	LV-5093	7:29	12:04	2.5	2.5	2.5	687.5	X			275	CE
JS13061411	Jun-13-14	1161-130614-ASB-JS-11	Inside Area (East)	LV-5093	13:23	16:00	2.5	2.3	2.3	361.1	X			157	CE
JS13061412	Jun-13-14	1161-130614-ASB-JS-12	Outside (Decon)	LV-5087	7:30	12:05	2.5	2.5	2.5	687.5	X			275	OS
JS13061413	Jun-13-14	1161-130614-ASB-JS-13	Outside (Decon)	LV-5087	13:24	16:02	2.5	2.4	2.4	379.2	X			158	OS

Turn Around Time: Normal: 7 days <u> X </u>				Rush: 24 hours <u> </u>		Rush: 16 hours <u> </u>	
Sampling Collected by:	Relinquished by:	Received by:	Relinquished by:	Received by:	Delivery to Lab by:	Received at Lab by:	
Jose A Santos						Jose A Santos	
Date: Time:	Date: Time:	Date: Time:	Date: Time:	Date: Time:	Date: Time:	Date: Time:	
Jun-13-14						Jun-13-14	



ALTOL ENVIRONMENTAL SERVICES, INC.
PO BOX 359 MERCEDITA, PR 00715-0359
FINAL DAILY PCM AIR MONITORING REPORT FOR FIELD ANALYSIS



Customer Name: Homeca Recycling and Demolition's Contact: Norma Collazo Phone / Fax/Email: 787-373-6722 Sampling Date: Jun-13-14 Analytical Method: NIOSH 7400 Collected By: Jose A Santos Delivery By: Jose A Santos Received By: Jose A Santos Analyzed By: Jose A Santos Altol Chemical Environmental Laboratory, Inc. Worker Name: Hector Montañez Worker Name: Jose E Santiago Worker Name: N/A Worker Name: N/A							Project Name: Esc. 1 Unidad Jorge Lucas Valdivieso Total Samples: 13 Job Number: ENJ-1161 Custody Record #: Collected ID: ASB-0912-0558-MS Delivery Date: Jun-14-14 Received Date: Jun-14-14 AIHA Lab ID: 199763 Worker ID: ASB-1013-0416-AW Worker ID: ASB-0913-0335-AW Worker ID: N/A Worker ID: N/A							
Project Description: Cleaning , rooms 4, 24 , 23 y 3 .														
Sample ID	Location	Type	TIME		FLOW RATE (LPM)	SAMPLE VOLUME (Liters)	TOTAL FIELDS COUNTED	TOTAL FIBERS COUNTED	FIBER DENSITY (f/mm2)	M.F.C (f/cc)	L.O.D (f/cc)	R.F.C (f/cc)	T.W.A 8hrs (f/cc)	
			START	STOP										
1161-130614-ASB-JS-01	Field Blank I	FB	----	----	----	---	100	0	0.0	----	----	----		
1161-130614-ASB-JS-02	Field Blank II	FB	0:00	----	----	---	100	0	0.0	----	----	----		
1161-130614-ASB-JS-03	Hector Montañez,Cleaning Rooms	E	7:26	7:56	1.6	48.0	100	8	10.2	0.0817	0.0563	0.0817	< 0.0563	
1161-130614-ASB-JS-04	Hector Montañez,Cleaning Rooms	PRCE	7:56	12:00	1.6	390.4	100	43	54.8	0.0540	0.0069	0.0540		
1161-130614-ASB-JS-05	Hector Montañez,Cleaning Rooms	PRCE	13:20	15:57	1.6	243.4	100	36	45.9	0.0726	0.0111	0.0726		
1161-130614-ASB-JS-06	Jose E Santiago, Cleaning Rooms	PRCE	7:27	12:02	1.6	440.0	100	43.5	55.4	0.0485	0.0061	0.0485	< 0.0520	
1161-130614-ASB-JS-07	Jose E Santiago, Cleaning Rooms	PRCE	13:21	15:58	1.6	251.2	100	38	48.4	0.0742	0.0107	0.0742		
MFC = Measured Fibers Concentration. LOD = Limit of Detection. RFC = Reported Fibers Concentration. T.W.A = Time Weighted Average. PR = Personal T= Type of Sample. BG = Background. EX = Exposure. OS = Outside. PP = Preparation. RM = Removal. CE = Cleaning. CL= Clearance. E = Excursion.														
Reported By: Jose A Santos Environmental Technician jose.santos@altolenterprises.com Phone: 787-507-1627					Signature: 		Verified By: Carlos Ocasio Altol Operation Manager carlos.ocasio@altolenterprises.com Phone: 787-835-4242 / 4229				Signature: 			
Date: Jun-13-14					Date:									



ALTOL ENVIRONMENTAL SERVICES, INC.
PO BOX 359 MERCEDITA, PR 00715-0359
FINAL DAILY PCM AIR MONITORING REPORT FOR FIELD ANALYSIS



Customer Name: Homeca Recycling and Demolition's Contact: Norma Collazo Phone / Fax/Email: 787-373-6722 Sampling Date: Jun-13-14 Analytical Method: NIOSH 7400 Collected By: Jose A Santos Delivery By: Jose A Santos Received By: Jose A Santos Analyzed By: Jose A Santos Altol Chemical Environmental Laboratory, Inc. Worker Name: Hector Montañez Worker Name: Jose E Santiago Worker Name: N/A Worker Name: N/A	Project Name: Esc. 1 Unidad Jorge Lucas Valdivieso Total Samples: 13 Job Number: ENJ-1161 Custody Record #: Collected ID: ASB-0912-0558-MS Delivery Date: Jun-14-14 Received Date: Jun-14-14 AIHA Lab ID: 199763 Worker ID: ASB-1013-0416-AW Worker ID: ASB-0913-0335-AW Worker ID: N/A Worker ID: N/A
--	--

Project Description: Cleaning , rooms 4, 24 , 23 y 3 .

Sample ID	Location	Type	TIME		FLOW RATE (LPM)	SAMPLE VOLUME (Liters)	TOTAL FIELDS COUNTED	TOTAL FIBERS COUNTED	FIBER DENSITY (f/mm2)	M.F.C (f/cc)	L.O.D (f/cc)	R.F.C (f/cc)	T.W.A 8hrs (f/cc)
			START	STOP									
1161-130614-ASB-JS-08	Inside Area (West)	CE	7:28	12:03	2.5	687.5	100	28.5	36.3	0.0203	0.0039	0.0203	
1161-130614-ASB-JS-09	Inside Area (West)	CE	13:22	15:59	2.5	392.5	100	24.5	31.2	0.0306	0.0069	0.0306	
1161-130614-ASB-JS-10	Inside Area (East)	CE	7:29	12:04	2.5	687.5	100	44.5	56.7	0.0317	0.0039	0.0317	
1161-130614-ASB-JS-11	Inside Area (East)	CE	13:23	16:00	2.5	392.5	100	39.5	50.3	0.0494	0.0069	0.0494	
1161-130614-ASB-JS-12	Outside (Decon)	OS	7:30	12:05	2.5	687.5	100	9	11.5	0.0064	0.0039	0.0064	
1161-130614-ASB-JS-13	Outside (Decon)	OS	13:24	16:02	2.5	395.0	100	13.5	17.2	0.0168	0.0068	0.0168	

MFC = Measured Fibers Concentration. LOD = Limit of Detection. RFC = Reported Fibers Concentration. T.W.A = Time Weighted Average. PR = Personal T= Type of Sample. BG = Background. EX = Exposure. OS = Outside. PP = Preparation. RM = Removal. CE = Cleaning. CL= Clearance. E = Excursion.

Reported By: Jose A Santos Environmental Technician jose.santos@altolenterprises.com Phone: 787-507-1627	Signature: 	Verified By: Carlos Ocasio Altol Operation Manager carlos.ocasio@altolenterprises.com Phone: 787-835-4242 / 4229	Signature:
Date: Jun-13-14		Date:	



ALTOL ENVIRONMENTAL SERVICES, INC.

PO BOX 359 MERCEDITA, PR 00715-0359

CHAIN OF CUSTODY (TRANSMITTAL SHEET FOR AIR SAMPLES)

PAGE ____ OF ____



Customer Name: <u>Homeca Recycling and Demolitions</u>					Project Name: <u>Esc Jorge Lucas Valdivieso 1 Unidad</u>										
Contact: <u>Norma Collazo</u>					Total Samples: <u>4</u>					Job Number: _____					
Phone / Fax/Email: <u>787-373-6722</u>					Worker Name: <u>N/A</u>					Worker ID: <u>N/A</u>					
Collected By: <u>Jose A Santos</u> <u>ASB-0912-0558-MS</u>					Worker Name: <u>N/A</u>					Worker ID: <u>N/A</u>					
Analyzed By Lab: <u>Altol Chemical Environmental Laboratory, Inc.</u>					Worker Name: <u>N/A</u>					Worker ID: <u>N/A</u>					
AIHA Lab ID: <u>199763</u>					Worker Name: <u>N/A</u>					Worker ID: <u>N/A</u>					
Project Description: Background collected in 0-101-01 office.															
Lab ID	Date	Sample ID	Sample Description	Pump	Time		Flow Rate			Volume (L)	Asbestos		Lea Air	Minutes	SAMPLE TYPE
					START	STOP	Initial	Final	Avg.		PCM	TEM			
JS13061401	Jun-13-14	1161-060614-ASB-JS-01	Field Blank I	-----	----	----	----	----	----	---	X			---	FB
JS13061402	Jun-13-14	1161-060614-ASB-JS-02	Field Blank II	-----	----	----	----	----	----	---	X			---	FB
JS13061403	Jun-13-14	1161-060614-ASB-JS-03	Background Collected in 0-101-01 Office (East)	HV-6152	9:02	12:18	10.0	10.0	10.0	1960.0	X			196	BG
JS13061404	Jun-13-14	1161-060614-ASB-JS-04	Background Collected in 0-101-01 Office (West)	HV-6153	9:04	12:19	10.0	10.0	10.0	1950.0	X			195	BG
Turn Around Time: Normal: 7 days <u> X </u> Rush: 24 hours <u> </u> Rush: 16 hours <u> </u>															
Sampling Collected by:		Relinquished by:		Received by:		Relinquished by:		Received by:		Delivery to Lab by:		Received at Lab by:			
Jose A Santos												Jose A Santos			
Date: <u>Jun-13-14</u> Time: <u> </u>		Date: <u> </u> Time: <u> </u>		Date: <u> </u> Time: <u> </u>		Date: <u> </u> Time: <u> </u>		Date: <u> </u> Time: <u> </u>		Date: <u> </u> Time: <u> </u>		Date: <u> </u> Time: <u> </u>			



ALTOL ENVIRONMENTAL SERVICES, INC.
PO BOX 359 MERCEDITA, PR 00715-0359
FINAL DAILY PCM AIR MONITORING REPORT FOR FIELD ANALYSIS




Customer Name: Homeca Recycling and Demolitions	Project Name: Esc Jorge Lucas Valdivieso 1 Unidad
Contact: Norma Collazo	Total Samples: 4 Job Number: _____
Phone / Fax/Email: 787-373-6722	Custody Record #: _____
Sampling Date: Jun-13-14 Analytical Method: NIOSH 7400	Collected ID: ASB-0912-0558-MS
Collected By: Jose A Santos	Delivery Date: Jun-14-14
Delivery By: Jose A Santos	Received Date: Jun-14-14
Received By: Jose A Santos	AIHA Lab ID: 199763
Analyzed By: Jose A Santos Altol Chemical Environmental Laboratory, Inc.	Worker ID: _____ N/A
Worker Name: N/A	Worker ID: _____ N/A
Worker Name: N/A	Worker ID: _____ N/A
Worker Name: N/A	Worker ID: _____ N/A

Project Description: Background collected in 0-101-01 office.

Sample ID	Location	Type	TIME		FLOW RATE (LPM)	SAMPLE VOLUME (Liters)	TOTAL FIELDS COUNTED	TOTAL FIBERS COUNTED	FIBER DENSITY (f/mm2)	M.F.C (f/cc)	L.O.D (f/cc)	R.F.C (f/cc)	T.W.A 8hrs (f/cc)
			START	STOP									
1161-130614-ASB-JS-01	Field Blank I	FB											
1161-130614-ASB-JS-02	Field Blank II	FB											
1161-130614-ASB-JS-03	Background Collected in 0-101-01 Office (East)	BG	9:02	12:18	10.0	1960.0	100	52.5	66.9	0.0131	0.0014	0.0131	<
1161-130614-ASB-JS-04	Background Collected in 0-101-01 Office (West)	BG	9:04	12:19	10.0	1950.0	100	45	57.3	0.0113	0.0014	0.0113	

MFC = Measured Fibers Concentration. LOD = Limit of Detection. RFC = Reported Fibers Concentration. T.W.A = Time Weighted Average. PR = Personal
T= Type of Sample. BG = Background. EX = Exposure. OS = Outside. PP = Preparation. RM = Removal. CE = Cleaning. CL= Clearance. E = Excursion.

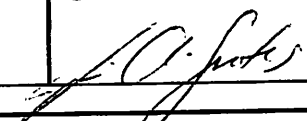Reported By: Jose A Santos Environmental Technician jose.santos@altolenterprises.com Phone: 787 507-1627	Signature: 	Verified By: Carlos Ocasio Altol Operation Manager carlos.ocasio@altolenterprises.com Phone: 787-835-4242 / 4229	Signature:
Date: Jun-13-14		Date:	





ALTOL ENVIRONMENTAL SERVICES, INC.
PO BOX 359 MERCEDITA, PR 00715-0359
FINAL DAILY PCM AIR MONITORING REPORT FOR FIELD ANALYSIS



Customer Name: Homeca Recycling and Demolitions Contact: Norma Collazo Phone / Fax/Email: 787-373-6722 Sampling Date: Jun-14-14 Analytical Method: NIOSH 7400 Collected By: Jose A Santos Delivery By: Jose A Santos Received By: Jose A Santos Analyzed By: Jose A Santos Altol Chemical Environmental Laboratory, Inc. Worker Name: N/A Worker Name: N/A Worker Name: N/A Worker Name: N/A						Project Name: Esc Jorge Lucas Valdivieso 1 Unidad Total Samples: 6 Job Number: ENJ-1161 Custody Record #: _____ Collected ID: ASB-0912-0558-MS Delivery Date: Jun-16-14 Received Date: Jun-16-14 AIHA Lab ID: 199763 Worker ID: _____ N/A Worker ID: _____ N/A Worker ID: _____ N/A Worker ID: _____ N/A							
Project Description: Backgrounds Collected in the following areas: Bathrooms Boys and girls, Floor 1 y 2													
Sample ID	Location	Type	TIME		FLOW RATE (LPM)	SAMPLE VOLUME (Liters)	TOTAL FIELDS COUNTED	TOTAL FIBERS COUNTED	FIBER DENSITY (f/mm2)	M.F.C (f/cc)	L.O.D (f/cc)	R.F.C (f/cc)	T.W.A 8hrs (f/cc)
			START	STOP									
1161-140614-ASB-JS-01	Field Blank I	FB											
1161-140614-ASB-JS-02	Field Blank II	FB											
1161-140614-ASB-JS-03	Background Collected in Boys Bathroom 2 Floor (Center)	BG	12:08	15:32	10.0	2040.0	100	55.5	70.7	0.0133	0.0013	0.0133	<
1161-140614-ASB-JS-04	Background Collected in Girls Bathroom 2 Floor (Center)	BG	12:09	15:33	10.0	2040.0	100	68.5	87.3	0.0165	0.0013	0.0165	
1161-140614-ASB-JS-05	Background Collected in Boys Bathroom 1 Floor (Center)	BG	12:10	15:35	10.0	2050.0	100	52	66.2	0.0124	0.0013	0.0124	
1161-140614-ASB-JS-06	Background Collected in Girls Bathroom 1 Floor (Center)	BG	12:13	15:36	10.0	2030.0	100	64.5	82.2	0.0156	0.0013	0.0156	
MFC = Measured Fibers Concentration. LOD = Limit of Detection. RFC = Reported Fibers Concentration. T.W.A = Time Weighted Average. PR = Personal T= Type of Sample. BG = Background. EX = Exposure. OS = Outside. PP = Preparation. RM = Removal. CE = Cleaning. CL= Clearance. E = Excursion.													
Reported By: Jose A Santos Environmental Technician jose.santos@altolenterprises.com Phone: 787 507-1627			Signature: 		Verified By: Carlos Ocasio Altol Operation Manager carlos.ocasio@altolenterprises.com Phone: 787-835-4242 / 4229			Signature: 					
Date: Jun-14-14					Date:								

Customer Name: **Homeca Recycling and Demolition's**

 Contact: **Norma Collazo**

 Phone / Fax/Email: **787-373-6722**

 Collected By: **Jose A Santos** **ASB-0912-0558-MS**

 Analized By Lab: **Altol Chemical Environmental Laboratory, Inc.**

 AIHA Lab ID: **199763**

 Project Name: **Esc. 1 Unidad Jorge Lucas Valdivieso**

 Total Samples: **11** Job Number: **ENJ-1161**

 Worker Name: **Felix Valentin** Worker ID: **ASB-1013-0415-AW**

 Worker Name: **Luis N Ortiz** Worker ID: **ASB-0414-0117-AW**

 Worker Name: **N/A** Worker ID: **N/A**

 Worker Name: **N/A** Worker ID: **N/A**

 Project Description: **Cleaning , rooms 4, 24 , and Bag Out**

Lab ID	Date	Sample ID	Sample Description	Pump	Time		Flow Rate			Volume (L)	Asbestos		Lead Air	Minutes	SAMPLE TYPE
					START	STOP	Initial	Final	Avg.		PCM	TEM			
JS14061401	Jun-14-14	1161-140614-ASB-JS-01	Field Blank I	-----	----	----	----	----	----	---	X			---	FB
JS14061402	Jun-14-14	1161-140614-ASB-JS-02	Field Blank II	-----		----	----	----	----	---	X			---	FB
JS14061403	Jun-14-14	1161-140614-ASB-JS-03	Luis N Ortiz,Cleaning Rooms	LV-2027	7:28	7:58	1.6	1.6	1.6	48.0	X			30	E
JS14061404	Jun-14-14	1161-140614-ASB-JS-04	Luis N Ortiz,Cleaning Rooms	LV-2027	7:59	11:56	1.6	1.6	1.6	379.2	X			237	PRCE
JS14061405	Jun-14-14	1161-140614-ASB-JS-05	Luis N Ortiz,Cleaning Rooms	LV-2027	13:07	15:16	1.6	1.5	1.6	200.0	X			129	PRCE
JS14061406	Jun-14-14	1161-140614-ASB-JS-06	Felix Valentin, Bag Out	LV-2072	7:36	10:20	1.6	1.6	1.6	262.4	X			164	PRCE
JS14061407	Jun-14-14	1161-140614-ASB-JS-07	Inside Area Room 24, 4	LV-2072	7:29	11:57	1.6	1.5	1.5	402.0	X			268	CE
JS14061408	Jun-14-14	1161-140614-ASB-JS-08	Inside Area Room 24, 4	LV-6124	13:08	15:18	2.5	2.5	2.5	325.0	X			130	CE
JS14061409	Jun-14-14	1161-140614-ASB-JS-09	Outside (Decon)	LV-6124	7:30	11:57	2.5	2.3	2.3	614.1	X			267	OS

 Turn Around Time: Normal: 7 days X Rush: 24 hours Rush: 16 hours

Sampling Collected by:	Relinquished by:	Received by:	Relinquished by:	Received by:	Delivery to Lab by:	Received at Lab by:
Jose A Santos						Jose A Santos
Date: Time:	Date: Time:	Date: Time:	Date: Time:	Date: Time:	Date: Time:	Date: Time:
Jun-14-14						Jun-14-14



ALTOL ENVIRONMENTAL SERVICES, INC.

PO BOX 359 MERCEDITA, PR 00715-0359
CHAIN OF CUSTODY (TRANSMITTAL SHEET FOR AIR SAMPLES)

PAGE ____ OF ____



Customer Name: <u>Homeca Recycling and Demolition's</u>	Project Name: <u>Esc. 1 Unidad Jorge Lucas Valdivieso</u>
Contact: <u>Norma Collazo</u>	Total Samples: <u>11</u> Job Number: <u>ENJ-1161</u>
Phone / Fax/Email: <u>787-373-6722</u>	Worker Name: <u>Felix Valentin</u> Worker ID: <u>ASB-1013-0415-AW</u>
Collected By: <u>Jose A Santos</u> <u>ASB-0912-0558-MS</u>	Worker Name: <u>Luis N Ortiz</u> Worker ID: <u>ASB-0414-0117-AW</u>
Analized By Lab: <u>Altol Chemical Environmental Laboratory, Inc.</u>	Worker Name: <u>N/A</u> Worker ID: <u>N/A</u>
AIHA Lab ID: <u>199763</u>	Worker Name: <u>N/A</u> Worker ID: <u>N/A</u>
Project Description: <u>Cleaning , rooms 4, 24 , and Bag Out</u>	


Lab ID	Date	Sample ID	Sample Description	Pump	Time		Flow Rate			Volume (L)	Asbestos		Lead Air	Minutes	SAMPLE TYPE
					START	STOP	Initial	Final	Avg.		PCM	TEM			
JS14061410	Jun-14-14	1161-140614-ASB-JS-10	Outside (Decon)	LV-5093	13:09	15:19	2.5	2.5	2.5	325.0	X			130	OS
JS14061411	Jun-14-14	1161-140614-ASB-JS-11	Outside (Dumpster)	LV-5093	7:37	10:24	2.5	2.3	2.3	384.1	X			167	OS

Turn Around Time: Normal: 7 days <u>__X__</u>		Rush: 24 hours <u>_____</u>		Rush: 16 hours <u>_____</u>		
Sampling Collected by:	Relinquished by:	Received by:	Relinquished by:	Received by:	Delivery to Lab by:	Received at Lab by:
Jose A Santos						Jose A Santos
Date: Time:	Date: Time:	Date: Time:	Date: Time:	Date: Time:	Date: Time:	Date: Time:
Jun-14-14						Jun-14-14



ALTOL ENVIRONMENTAL SERVICES, INC.
PO BOX 359 MERCEDITA, PR 00715-0359
FINAL DAILY PCM AIR MONITORING REPORT FOR FIELD ANALYSIS

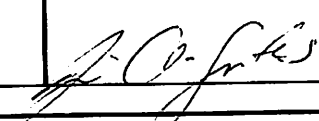

Customer Name: Homeca Recycling and Demolition's Contact: Norma Collazo Phone / Fax/Email: 787-373-6722 Sampling Date: Jun-14-14 Analytical Method: NIOSH 7400 Collected By: Jose A Santos Delivery By: Jose A Santos Received By: Jose A Santos Analyzed By: Jose A Santos Altol Chemical Environmental Laboratory, Inc. Worker Name: Felix Valentin Worker Name: Luis N Ortiz Worker Name: N/A Worker Name: N/A							Project Name: Esc. 1 Unidad Jorge Lucas Valdivieso Total Samples: 11 Job Number: ENJ-1161 Custody Record #: Collected ID: ASB-0912-0558-MS Delivery Date: Jun-16-14 Received Date: Jun-16-14 AIHA Lab ID: 199763 Worker ID: ASB-1013-0415-AW Worker ID: ASB-0414-0117-AW Worker ID: N/A Worker ID: N/A						
Project Description: Cleaning , rooms 4, 24 , and Bag Out													
Sample ID	Location	Type	TIME		FLOW RATE (LPM)	SAMPLE VOLUME (Liters)	TOTAL FIELDS COUNTED	TOTAL FIBERS COUNTED	FIBER DENSITY (f/mm2)	M.F.C (f/cc)	L.O.D (f/cc)	R.F.C (f/cc)	T.W.A 8hrs (f/cc)
			START	STOP									
1161-140614-ASB-JS-01	Field Blank I	FB	----	----	----	---	100	0	0.0	----	----	----	
1161-140614-ASB-JS-02	Field Blank II	FB	0:00	----	----	---	100	0	0.0	----	----	----	
1161-140614-ASB-JS-03	Luis N Ortiz,Cleaning Rooms	E	7:28	7:58	1.6	48.0	100	7.5	9.6	0.0766	0.0563	0.0766	< 0.0417
1161-140614-ASB-JS-04	Luis N Ortiz,Cleaning Rooms	PRCE	7:59	11:56	1.6	379.2	100	31.5	40.1	0.0407	0.0071	0.0407	
1161-140614-ASB-JS-05	Luis N Ortiz,Cleaning Rooms	PRCE	13:07	15:16	1.6	200.0	100	25.5	32.5	0.0625	0.0135	0.0625	
1161-140614-ASB-JS-06	Felix Valentin, Bag Out	PRCE	7:36	10:20	1.6	262.4	100	49.5	63.1	0.0925	0.0103	0.0925	<
1161-140614-ASB-JS-07	Inside Area Room 24, 4	CE	7:29	11:57	1.6	428.8	100	31	39.5	0.0355	0.0063	0.0355	
MFC = Measured Fibers Concentration. LOD = Limit of Detection. RFC = Reported Fibers Concentration. T.W.A = Time Weighted Average. PR = Personal T= Type of Sample. BG = Background. EX = Exposure. OS = Outside. PP = Preparation. RM = Removal. CE = Cleaning. CL= Clearance. E = Excursion.													
Reported By: Jose A Santos Environmental Technician jose.santos@altolenterprises.com Phone: 787-507-1627			Signature: 			Verified By: Carlos Ocasio Altol Operation Manager carlos.ocasio@altolenterprises.com Phone: 787-835-4242 / 4229			Signature:				
Date: Jun-14-14						Date:							



ALTOL ENVIRONMENTAL SERVICES, INC.
PO BOX 359 MERCEDITA, PR 00715-0359
FINAL DAILY PCM AIR MONITORING REPORT FOR FIELD ANALYSIS



Customer Name: Homeca Recycling and Demolition's Contact: Norma Collazo Phone / Fax/Email: 787-373-6722 Sampling Date: Jun-14-14 Analytical Method: NIOSH 7400 Collected By: Jose A Santos Delivery By: Jose A Santos Received By: Jose A Santos Analyzed By: Jose A Santos Altol Chemical Environmental Laboratory, Inc. Worker Name: Felix Valentin Worker Name: Luis N Ortiz Worker Name: N/A Worker Name: N/A	Project Name: Esc. 1 Unidad Jorge Lucas Valdivieso Total Samples: 11 Job Number: ENJ-1161 Custody Record #: Collected ID: ASB-0912-0558-MS Delivery Date: Jun-16-14 Received Date: Jun-16-14 AIHA Lab ID: 199763 Worker ID: ASB-1013-0415-AW Worker ID: ASB-0414-0117-AW Worker ID: N/A Worker ID: N/A
--	--

Project Description: Cleaning , rooms 4, 24 , and Bag Out

Sample ID	Location	Type	TIME		FLOW RATE (LPM)	SAMPLE VOLUME (Liters)	TOTAL FIELDS COUNTED	TOTAL FIBERS COUNTED	FIBER DENSITY (f/mm2)	M.F.C (f/cc)	L.O.D (f/cc)	R.F.C (f/cc)	T.W.A 8hrs (f/cc)
			START	STOP									
1161-140614-ASB-JS-08	Inside Area Room 24, 4	CE	13:08	15:18	2.5	325.0	100	23.5	29.9	0.0355	0.0083	0.0355	
1161-140614-ASB-JS-09	Outside (Decon)	OS	7:30	11:57	2.5	667.5	100	7	8.9	0.0051	0.0040	0.0051	
1161-140614-ASB-JS-10	Outside (Decon)	OS	13:09	15:19	2.5	325.0	100	9	11.5	0.0136	0.0083	0.0136	
1161-140614-ASB-JS-11	Outside (Dumpster)	OS	7:37	10:24	2.5	417.5	100	35.5	45.2	0.0417	0.0065	0.0417	

MFC = Measured Fibers Concentration. LOD = Limit of Detection. RFC = Reported Fibers Concentration. T.W.A = Time Weighted Average. PR = Personal T= Type of Sample. BG = Background. EX = Exposure. OS = Outside. PP = Preparation. RM = Removal. CE = Cleaning. CL= Clearance. E = Excursion.

Reported By: Jose A Santos Environmental Technician jose.santos@altolenterprises.com Phone: 787-507-1627	Signature: 	Verified By: Carlos Ocasio Altol Operation Manager carlos.ocasio@altolenterprises.com Phone: 787-835-4242 / 4229	Signature:
Date: Jun-14-14		Date:	

**ALTOL ENVIRONMENTAL SERVICES, INC.**

PO BOX 359 MERCEDITA, PR 00715-0359

CHAIN OF CUSTODY (TRANSMITTAL SHEET FOR AIR SAMPLES)

PAGE ____ OF ____



Customer Name: Homeca Recycling and Demolition's	Project Name: Esc. 1 Unidad Jorge Lucas Valdivieso
Contact: Norma Collazo	Total Samples: 8 Job Number: ENJ-1161
Phone / Fax/Email: 787-373-6722	Worker Name: Felix Valentin Worker ID: ASB-1013-0415-AW
Collected By: Jose A Santos ASB-0912-0558-MS	Worker Name: N/A Worker ID: N/A
Analized By Lab: Altol Chemical Environmental Laboratory, Inc.	Worker Name: N/A Worker ID: N/A
AIHA Lab ID: 199763	Worker Name: N/A Worker ID: N/A

Project Description: **Cleaning Bathrooms Boys and Girls Floor 1 and 2 .**

Lab ID	Date	Sample ID	Sample Description	Pump	Time		Flow Rate			Volume (L)	Asbestos		Lea Air	Minutes	SAMPLE TYPE
					START	STOP	Initial	Final	Avg.		PCM	TEM			
JS16081401	Jun-16-14	1161-160614-ASB-JS-01	Field Blank I	-----	----	----	----	----	----	---	X			---	FB
JS16081402	Jun-16-14	1161-160614-ASB-JS-02	Field Blank II	-----		----	----	----	----	---	X			---	FB
JS16081403	Jun-16-14	1161-160614-ASB-JS-03	Felix Valentin, Cleaning Bathrooms Girl Floor 1	LV-6124	7:34	8:05	1.6	1.6	1.6	49.6	X			31	E
JS16081404	Jun-16-14	1161-160614-ASB-JS-04	Felix Valentin, Cleaning Bathrooms Girls Floor 1	LV-6124	8:05	9:48	1.6	1.6	1.6	164.8	X			103	PREX
JS16081405	Jun-16-14	1161-160614-ASB-JS-05	Felix Valentin, Cleaning Bathrooms Boys Floor 1	LV-6124	9:50	11:56	1.6	1.5	1.6	195.3	X			126	PREX
JS16081406	Jun-16-14	1161-160614-ASB-JS-06	Felix Valentin, Cleaning Bathrooms Girls Floor 2	LV-6124	13:20	15:42	1.6	1.6	1.6	227.2	X			142	PREX
JS16081407	Jun-16-14	1161-160614-ASB-JS-07	Outside (Exterior) Bathrooms boys and Girls Floor 1	LV-2072	7:36	11:58	2.5	2.5	2.5	655.0	X			262	OS
JS16081408	Jun-16-14	1161-160614-ASB-JS-08	Outside (Exterior) Bathrooms Girls Floor 2	LV-2019	13:22	15:43	2.5	2.5	2.5	352.5	X			141	OS

Turn Around Time: Normal: 7 days X Rush: 24 hours Rush: 16 hours

Sampling Collected by:	Relinquished by:	Received by:	Relinquished by:	Received by:	Delivery to Lab by:	Received at Lab by:
Jose A Santos						Jose A Santos
Date: Time:	Date: Time:	Date: Time:	Date: Time:	Date: Time:	Date: Time:	Date: Time:
Jun-16-14						Jun-16-14



ALTOL ENVIRONMENTAL SERVICES, INC.
PO BOX 359 MERCEDITA, PR 00715-0359
FINAL DAILY PCM AIR MONITORING REPORT FOR FIELD ANALYSIS



Customer Name: Homeca Recycling and Demolition's Contact: Norma Collazo Phone / Fax/Email: 787-373-6722 Sampling Date: Jun-16-14 Analytical Method: NIOSH 7400 Collected By: Jose A Santos Delivery By: Jose A Santos Received By: Jose A Santos Analyzed By: Jose A Santos Altol Chemical Environmental Laboratory, Inc. Worker Name: Felix Valentin Worker Name: N/A Worker Name: N/A Worker Name: N/A	Project Name: Esc. 1 Unidad Jorge Lucas Valdivieso Total Samples: 8 Job Number: ENJ-1161 Custody Record #: Collected ID: ASB-0912-0558-MS Delivery Date: Jun-17-14 Received Date: Jun-17-14 AIHA Lab ID: 199763 Worker ID: ASB-1013-0415-AW Worker ID: N/A Worker ID: N/A Worker ID: N/A
---	--

Project Description: Cleaning Bathrooms Boys and Girls Floor 1 and 2.

Sample ID	Location	Type	TIME		FLOW RATE (LPM)	SAMPLE VOLUME (Liters)	TOTAL FIELDS COUNTED	TOTAL FIBERS COUNTED	FIBER DENSITY (f/mm2)	M.F.C (f/cc)	L.O.D (f/cc)	R.F.C (f/cc)	T.W.A 8hrs (f/cc)
			START	STOP									
1161-160614-ASB-JS-01	Field Blank I	FB	----	----	----	---	100	0	0.0	----	----	----	
1161-160614-ASB-JS-02	Field Blank II	FB	0:00	----	----	---	100	0	0.0	----	----	----	
1161-160614-ASB-JS-03	Felix Valentin, Cleaning Bathrooms Girl Floor 1	E	7:34	8:05	1.6	49.6	100	13.5	17.2	0.1335	0.0544	0.1335	< 0.0600
1161-160614-ASB-JS-04	Felix Valentin, Cleaning Bathrooms Girls Floor 1	PREX	8:05	9:48	1.6	164.8	100	19	24.2	0.0565	0.0164	0.0565	
1161-160614-ASB-JS-05	Felix Valentin, Cleaning Bathrooms Boys Floor 1	PREX	9:50	11:56	1.6	195.3	100	28	35.7	0.0703	0.0138	0.0703	
1161-160614-ASB-JS-06	Felix Valentin, Cleaning Bathrooms Girls Floor 2	PREX	13:20	15:42	1.6	227.2	100	32.5	41.4	0.0702	0.0119	0.0702	
1161-160614-ASB-JS-07	Outside (Exterior) Bathrooms boys and Girls Floor 1	OS	7:36	11:58	1.6	419.2	100	11	14.0	0.0129	0.0064	0.0129	


MFC = Measured Fibers Concentration. LOD = Limit of Detection. RFC = Reported Fibers Concentration. T.W.A = Time Weighted Average. PR = Personal T = Type of Sample. BG = Background. EX = Exposure. OS = Outside. PP = Preparation. RM = Removal. CE = Cleaning. CL= Clearance. E = Excursion.

Reported By: Jose A Santos Environmental Technician jose.santos@altolenterprises.com Phone: 787-507-1627	Signature: 	Verified By: Carlos Ocasio Altol Operation Manager carlos.ocasio@altolenterprises.com Phone: 787-835-4242 / 4229	Signature:
Date: Jun-16-14		Date:	



ALTOL ENVIRONMENTAL SERVICES, INC.
PO BOX 359 MERCEDITA, PR 00715-0359
FINAL DAILY PCM AIR MONITORING REPORT FOR FIELD ANALYSIS

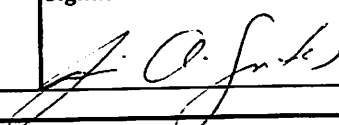

Customer Name: Homeca Recycling and Demolition's Contact: Norma Collazo Phone / Fax/Email: 787-373-6722 Sampling Date: Jun-16-14 Analytical Method: NIOSH 7400 Collected By: Jose A Santos Delivery By: Jose A Santos Received By: Jose A Santos Analyzed By: Jose A Santos Altol Chemical Environmental Laboratory, Inc. Worker Name: Felix Valentin Worker Name: N/A Worker Name: N/A Worker Name: N/A							Project Name: Esc. 1 Unidad Jorge Lucas Valdivieso Total Samples: 8 Job Number: ENJ-1161 Custody Record #: Collected ID: ASB-0912-0558-MS Delivery Date: Jun-17-14 Received Date: Jun-17-14 AIHA Lab ID: 199763 Worker ID: ASB-1013-0415-AW Worker ID: N/A Worker ID: N/A Worker ID: N/A						
Project Description: Cleaning Bathrooms Boys and Girls Floor 1 and 2.													
Sample ID	Location	Type	TIME		FLOW RATE (LPM)	SAMPLE VOLUME (Liters)	TOTAL FIELDS COUNTED	TOTAL FIBERS COUNTED	FIBER DENSITY (f/mm2)	M.F.C (f/cc)	L.O.D (f/cc)	R.F.C (f/cc)	T.W.A 8hrs (f/cc)
			START	STOP									
1161-160614-ASB-JS-08	Outside (Exterior) Bathrooms Girls Floor 2	OS	13:22	15:43	2.5	352.5	100	39.5	50.3	0.0550	0.0077	0.0550	
MFC = Measured Fibers Concentration. LOD = Limit of Detection. RFC = Reported Fibers Concentration. T.W.A = Time Weighted Average. PR = Personal T= Type of Sample. BG = Background. EX = Exposure. OS = Outside. PP = Preparation. RM = Removal. CE = Cleaning. CL= Clearance. E = Excursion.													
Reported By: Jose A Santos Environmental Technician jose.santos@altolenterprises.com Phone: 787-507-1627			Signature: 			Verified By: Carlos Ocasio Altol Operation Manager carlos.ocasio@altolenterprises.com Phone: 787-835-4242 / 4229			Signature:				
Date: Jun-16-14						Date:							

Customer Name: <u>Homeca Recycling and Demolition's</u>					Project Name: <u>Esc. 1 Unidad Jorge Lucas Valdivieso</u>									
Contact: <u>Norma Collazo</u>					Total Samples: <u>11</u>					Job Number: <u>ENJ-1161</u>				
Phone / Fax/Email: <u>787-373-6722</u>					Worker Name: <u>Emmanuel Ramos</u>					Worker ID: <u>ASB-0913-0335-AW</u>				
Collected By: <u>Jose A Santos</u> <u>ASB-0912-0558-MS</u>					Worker Name: <u>Hector Montañez</u>					Worker ID: <u>ASB-1013-0416-AW</u>				
Analized By Lab: <u>Altol Chemical Environmental Laboratory, Inc.</u>					Worker Name: <u>N/A</u>					Worker ID: <u>N/A</u>				
AIHA Lab ID: <u>199763</u>					Worker Name: <u>N/A</u>					Worker ID: <u>N/A</u>				
Project Description: <u>Cleaning Dining Room.</u>														

Lab ID	Date	Sample ID	Sample Description	Pump	Time		Flow Rate			Volume (L)	Asbestos		Lead Air	Minutes	SAMPLE TYPE
					START	STOP	Initial	Final	Avg.		PCM	TEM			
JS17061401	Jun-17-14	1161-170614-ASB-JS-01	Field Blank I	-----	----	----	----	----	----	----	X			---	FB
JS17061402	Jun-17-14	1161-170614-ASB-JS-02	Field Blank II	-----		----	----	----	----	----	X			---	FB
JS17061403	Jun-17-14	1161-170614-ASB-JS-03	Emmanuel Ramos, Cleaning Dining Room	LV-6124	7:29	7:59	1.6	1.6	1.6	48.0	X			30	E
JS17061404	Jun-17-14	1161-170614-ASB-JS-04	Emmanuel Ramos, Cleaning Dining Room	LV-6124	8:02	11:46	1.6	1.6	1.6	358.4	X			224	PRCE
JS17061405	Jun-17-14	1161-170614-ASB-JS-05	Emmanuel Ramos, Cleaning Dining Room	LV-6124	13:17	15:52	1.6	1.5	1.6	240.3	X			155	PRCE
JS17061406	Jun-17-14	1161-170614-ASB-JS-06	Hector Montañez, Cleaning Dining Room	LV-2072	7:30	11:48	1.6	1.6	1.6	412.8	X			258	PRCE
JS17061407	Jun-17-14	1161-170614-ASB-JS-07	Hector Montañez, Cleaning Dining Room	LV-2072	13:18	15:53	1.6	1.5	1.5	232.5	X			155	PRCE
JS17061408	Jun-17-14	1161-170614-ASB-JS-08	Inside Area	LV-2019	7:31	11:50	2.5	2.5	2.5	647.5	X			259	EX
JS17061409	Jun-17-14	1161-170614-ASB-JS-09	Inside Area	LV-2019	13:20	15:54	2.5	2.4	2.4	369.6	X			154	EX

Turn Around Time: Normal: 7 days <u> X </u>		Rush: 24 hours <u> </u>		Rush: 16 hours <u> </u>	
---	--	----------------------------------	--	----------------------------------	--

Sampling Collected by:	Relinquished by:	Received by:	Relinquished by:	Received by:	Delivery to Lab by:	Received at Lab by:
Jose A Santos						Jose A Santos
Date: Jun-17-14	Time:	Date:	Time:	Date:	Time:	Date: Jun-17-14

[illegible]



ALTOL ENVIRONMENTAL SERVICES, INC.
PO BOX 359 MERCEDITA, PR 00715-0359
FINAL DAILY PCM AIR MONITORING REPORT FOR FIELD ANALYSIS




Customer Name: Homeca Recycling and Demolition's	Project Name: Esc. 1 Unidad Jorge Lucas Valdivieso
Contact: Norma Collazo	Total Samples: 11 Job Number: ENJ-1161
Phone / Fax/Email: 787-373-6722	Custody Record #:
Sampling Date: Jun-17-14 Analytical Method: NIOSH 7400	Collected ID: ASB-0912-0558-MS
Collected By: Jose A Santos	Delivery Date: Jun-18-14
Delivery By: Jose A Santos	Received Date: Jun-18-14
Received By: Jose A Santos	AIHA Lab ID: 199763
Analyzed By: Jose A Santos Altol Chemical Environmental Laboratory, Inc.	Worker ID: ASB-0913-0335-AW
Worker Name: Emmanuel Ramos	Worker ID: ASB-1013-0416-AW
Worker Name: Hector Montañez	Worker ID: N/A
Worker Name: N/A	Worker ID: N/A
Worker Name: N/A	Worker ID: N/A

Project Description: Cleaning Dining Room.

Sample ID	Location	Type	TIME		FLOW RATE (LPM)	SAMPLE VOLUME (Liters)	TOTAL FIELDS COUNTED	TOTAL FIBERS COUNTED	FIBER DENSITY (f/mm2)	M.F.C (f/cc)	L.O.D (f/cc)	R.F.C (f/cc)	T.W.A 8hrs (f/cc)
			START	STOP									
1161-170614-ASB-JS-01	Field Blank I	FB	----	----	----	---	100	0	0.0	----	----	----	
1161-170614-ASB-JS-02	Field Blank II	FB	0:00	----	----	---	100	0	0.0	----	----	----	
1161-170614-ASB-JS-03	Emmanuel Ramos, Cleaning Dining Room	E	7:29	7:59	1.6	48.0	100	18	22.9	0.1839	0.0563	0.1839	< 0.0848
1161-170614-ASB-JS-04	Emmanuel Ramos, Cleaning Dining Room	PRCE	8:02	11:46	1.6	358.4	100	31.5	40.1	0.0431	0.0075	0.0431	
1161-170614-ASB-JS-05	Emmanuel Ramos, Cleaning Dining Room	PRCE	13:17	15:52	1.6	240.3	100	40.5	51.6	0.0827	0.0112	0.0827	
1161-170614-ASB-JS-06	Hector Montañez, Cleaning Dining Room	PRCE	7:30	11:48	1.6	412.8	100	41.5	52.9	0.0493	0.0065	0.0493	< 0.0514
1161-170614-ASB-JS-07	Hector Montañez, Cleaning Dining Room	PRCE	13:18	15:53	1.6	248.0	100	39	49.7	0.0771	0.0109	0.0771	


MFC = Measured Fibers Concentration. LOD = Limit of Detection. RFC = Reported Fibers Concentration. T.W.A = Time Weighted Average. PR = Personal T= Type of Sample. BG = Background. EX = Exposure. OS = Outside. PP = Preparation. RM = Removal. CE = Cleaning. CL= Clearance. E = Excursion.

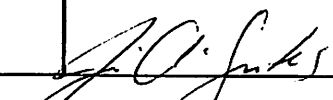Reported By: Jose A Santos Environmental Technician jose.santos@altolenterprises.com Phone: 787-507-1627	Signature: 	Verified By: Carlos Ocasio Altol Operation Manager carlos.ocasio@altolenterprises.com Phone: 787-835-4242 / 4229	Signature:
Date: Jun-17-14		Date:	



ALTOL ENVIRONMENTAL SERVICES, INC.
PO BOX 359 MERCEDITA, PR 00715-0359
FINAL DAILY PCM AIR MONITORING REPORT FOR FIELD ANALYSIS

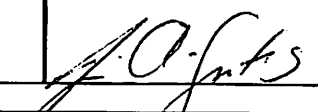

Customer Name: Homeca Recycling and Demolition's Contact: Norma Collazo Phone / Fax/Email: 787-373-6722 Sampling Date: Jun-17-14 Analytical Method: NIOSH 7400 Collected By: Jose A Santos Delivery By: Jose A Santos Received By: Jose A Santos Analyzed By: Jose A Santos Altol Chemical Environmental Laboratory, Inc. Worker Name: Emmanuel Ramos Worker Name: Hector Montañez Worker Name: N/A Worker Name: N/A						Project Name: Esc. 1 Unidad Jorge Lucas Valdivieso Total Samples: 11 Job Number: ENJ-1161 Custody Record #: Collected ID: ASB-0912-0558-MS Delivery Date: Jun-18-14 Received Date: Jun-18-14 AIHA Lab ID: 199763 Worker ID: ASB-0913-0335-AW Worker ID: ASB-1013-0416-AW Worker ID: N/A Worker ID: N/A							
Project Description: Cleaning Dining Room.													
Sample ID	Location	Type	TIME		FLOW RATE (LPM)	SAMPLE VOLUME (Liters)	TOTAL FIELDS COUNTED	TOTAL FIBERS COUNTED	FIBER DENSITY (f/mm2)	M.F.C (f/cc)	L.O.D (f/cc)	R.F.C (f/cc)	T.W.A 8hrs (f/cc)
			START	STOP									
1161-170614-ASB-JS-08	Inside Area	EX	7:31	11:50	2.5	647.5	100	42.5	54.1	0.0322	0.0042	0.0322	
1161-170614-ASB-JS-09	Inside Area	EX	13:20	15:54	2.5	385.0	100	31.5	40.1	0.0401	0.0070	0.0401	
1161-170614-ASB-JS-10	Outside (Decon)	OS	7:32	11:52	2.5	650.0	100	9.5	12.1	0.0072	0.0042	0.0072	
1161-170614-ASB-JS-11	Outside (Decon)	OS	13:22	15:56	2.5	385.0	100	11.5	14.6	0.0146	0.0070	0.0146	
<i>MFC = Measured Fibers Concentration. LOD = Limit of Detection. RFC = Reported Fibers Concentration. T.W.A = Time Weighted Average. PR = Personal T= Type of Sample. BG = Background. EX = Exposure. OS = Outside. PP = Preparation. RM = Removal. CE = Cleaning. CL= Clearance. E = Excursion.</i>													
Reported By: Jose A Santos Environmental Technician jose.santos@altolenterprises.com Phone: 787-507-1627			Signature: 			Verified By: Carlos Ocasio Altol Operation Manager carlos.ocasio@altolenterprises.com Phone: 787-835-4242 / 4229			Signature:				
Date: Jun-17-14						Date:							

Customer Name: <u>Homeca Recycling and Demolitions</u> Contact: <u>Melvin Feliciano</u> Phone / Fax/Email: <u>787-426-1597</u> Collected By: <u>Jose A Santos</u> <u>ASB-0912-0558-MS</u> Analyzed By Lab: <u>Altol Chemical Environmental Laboratory, Inc.</u> AIHA Lab ID: <u>199763</u>	Project Name: <u>1 ra Unidad Esc Jorge Lucas Valdiviezo</u> Total Samples: <u>17</u> Job Number: <u>ENJ-1161</u> Worker Name: <u>Jose M Rodriguez</u> Worker ID: <u>ASB-0913-0340-AW</u> Worker Name: <u>Felix R Valentin</u> Worker ID: <u>ASB-1013-0415-AW</u> Worker Name: <u>Eliceo Caraballo</u> Worker ID: <u>ASB-1213-0505-AW</u> Worker Name: <u>N/A</u> Worker ID: <u>N/A</u>
---	--

Project Description: Cleaning Dining Room and Room # 4

Lab ID	Date	Sample ID	Sample Description	Pump	Time		Flow Rate			Volume (L)	Asbestos		Lead Air	Minutes	SAMPLE TYPE
					START	STOP	Initial	Final	Avg.		PCM	TEM			
JS18061401	Jun-18-14	1161-180614-ASB-JS-01	Field Blank I	-----	----	----	----	----	----	---	X			---	FB
JS18061402	Jun-18-14	1161-180614-ASB-JS-02	Field Blank II	-----	----	----	----	----	----	---	X			---	FB
JS18061403	Jun-18-14	1161-180614-ASB-JS-03	Felix Valentin, Cleaning Dining Room	LV-6124	7:32	8:04	1.6	1.6	1.6	51.2	X			32	E
JS18061404	Jun-18-14	1161-180614-ASB-JS-04	Felix Valentin, Cleaning Dining Room	LV-6124	8:05	11:55	1.6	1.6	1.6	368.0	X			230	PRCE
JS18061405	Jun-18-14	1161-180614-ASB-JS-05	Felix Valentin, Cleaning Dining Room	LV-6124	13:15	15:46	1.6	1.5	1.5	226.5	X			151	PRCE
JS18061406	Jun-18-14	1161-180614-ASB-JS-06	Jose M Rodriguez, Cleaning Dining Room	LV-2022	7:34	11:56	1.6	1.6	1.6	419.2	X			262	PRCE
JS18061407	Jun-18-14	1161-180614-ASB-JS-07	Jose M Rodriguez, Cleaning Dining Room	LV-2022	13:16	15:48	1.6	1.5	1.5	228.0	X			152	PRCE
JS18061408	Jun-18-14	1161-180614-ASB-JS-08	Eliceo Caraballo, Cleaning Room # 4	LV-2046	7:40	12:02	1.6	1.6	1.6	419.2	X			262	PRCE
JS18061409	Jun-18-14	1161-180614-ASB-JS-09	Eliceo Caraballo, Cleaning Room # 4	LV-2046	13:32	15:57	1.6	1.4	1.4	203.0	X			145	PRCE

Turn Around Time: Normal: 7 days X Rush: 24 hours _____ Rush: 16 hours _____

Sampling Collected by:	Relinquished by:	Received by:	Relinquished by:	Received by:	Delivery to Lab by:	Received at Lab by:
Jose A Santos						Jose A Santos
Date: Time:	Date: Time:	Date: Time:	Date: Time:	Date: Time:	Date: Time:	Date: Time:
Jun-18-14						Jun-18-14

**ALTOL ENVIRONMENTAL SERVICES, INC.**

PO BOX 359 MERCEDITA, PR 00715-0359

CHAIN OF CUSTODY (TRANSMITTAL SHEET FOR AIR SAMPLES)

PAGE ____ OF ____



Customer Name: Homeca Recycling and Demolitions	Project Name: 1 ra Unidad Esc Jorge Lucas Valdiviezo
Contact: Melvin Feliciano	Total Samples: 17 Job Number: ENJ-1161
Phone / Fax/Email: 787-426-1597	Worker Name: Jose M Rodriguez Worker ID: ASB-0913-0340-AW
Collected By: Jose A Santos ASB-0912-0558-MS	Worker Name: Felix R Valentin Worker ID: ASB-1013-0415-AW
Analyzed By Lab: Altol Chemical Environmental Laboratory, Inc.	Worker Name: Eliceo Caraballo Worker ID: ASB-1213-0505-AW
AIHA Lab ID: 199763	Worker Name: N/A Worker ID: N/A

Project Description: **Cleaning Dining Room and Room # 4**

JS18061410	Jun-18-14	1161-180614-ASB-JS-10	Inside Area (Dining Room)	LV-2019	7:35	11:57	2.5	2.5	2.5	655.0	X			262	CE
JS18061411	Jun-18-14	1161-180614-ASB-JS-11	Inside Area (Dining Room)	LV-2019	13:18	15:49	2.5	2.3	2.3	347.3	X			151	CE
JS18061412	Jun-18-14	1161-180614-ASB-JS-12	Inside Area (Room # 4)	LV-5087	7:41	12:03	2.5	2.5	2.5	655.0	X			262	CE
JS18061413	Jun-18-14	1161-180614-ASB-JS-13	Inside Area (Room # 4)	LV-5087	13:34	15:58	2.5	2.4	2.4	345.6	X			144	CE
JS18061414	Jun-18-14	1161-180614-ASB-JS-14	Outside Area (Decon, Dining Room)	LV-5093	7:36	11:58	2.5	2.5	2.5	655.0	X			262	OS
JS18061415	Jun-18-14	1161-180614-ASB-JS-15	Outside Area (Decon, Dining Room)	LV-5093	13:20	15:50	2.5	2.4	2.4	360.0	X			150	OS
JS18061416	Jun-18-14	1161-180614-ASB-JS-16	Outside Area (Decon Room # 4)	LV-2072	7:42	12:04	2.5	2.5	2.5	655.0	X			262	OS
JS18061417	Jun-18-14	1161-180614-ASB-JS-17	Outside Area (Decon Room # 4)	LV-2072	13:35	15:59	2.5	2.4	2.4	345.6	X			144	OS


Turn Around Time: Normal: 7 days X Rush: 24 hours Rush: 16 hours

Sampling Collected by:	Relinquished by:	Received by:	Relinquished by:	Received by:	Delivery to Lab by:	Received at Lab by:
Jose A Santos						Jose A Santos
Date: Time:	Date: Time:	Date: Time:	Date: Time:	Date: Time:	Date: Time:	Date: Time:
Jun-18-14						Jun-18-14



ALTOL ENVIRONMENTAL SERVICES, INC.
PO BOX 359 MERCEDITA, PR 00715-0359
FINAL DAILY PCM AIR MONITORING REPORT FOR FIELD ANALYSIS

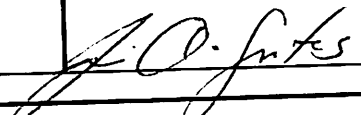

Customer Name: Homeca Recycling and Demolitions Contact: Melvin Feliciano Phone / Fax/Email: 787-426-1597 Sampling Date: Jun-18-14 Analytical Method: NIOSH 7400 Collected By: Jose A Santos Delivery By: Jose A Santos Received By: Jose A Santos Analyzed By: Jose A Santos Altol Chemical Environmental Laboratory, Inc. Worker Name: Jose M Rodriguez Worker Name: Felix R Valentin Worker Name: Eliceo Caraballo Worker Name: N/A								Project Name: 1 ra Unidad Esc Jorge Lucas Valdiviezo Total Samples: 17 Job Number: ENJ-1161 Custody Record #: Collected ID: ASB-0912-0558-MS Delivery Date: Jun-19-14 Received Date: Jun-19-14 AIHA Lab ID: 199763 Worker ID: ASB-0913-0340-AW Worker ID: ASB-1013-0415-AW Worker ID: ASB-1213-0505-AW Worker ID: N/A							
Project Description: Cleaning Dining Room and Room # 4															
Sample ID	Location	Type	TIME		FLOW RATE (LPM)	SAMPLE VOLUME (Liters)	TOTAL FIELDS COUNTED	TOTAL FIBERS COUNTED	FIBER DENSITY (f/mm2)	M.F.C (f/cc)	L.O.D (f/cc)	R.F.C (f/cc)	T.W.A 8hrs (f/cc)		
			START	STOP											
1161-180614-ASB-JS-01	Field Blank I	FB	----	----	----	---	100	0	0.0	----	----	----			
1161-180614-ASB-JS-02	Field Blank II	FB	----	----	----	---	100	0	0.0	----	----	----			
1161-180614-ASB-JS-03	Felix Valentin, Cleaning Dining Room	E	7:32	8:04	1.6	51.2	100	13.5	17.2	0.1293	0.0527	0.1293	< 0.0499		
1161-180614-ASB-JS-04	Felix Valentin, Cleaning Dining Room	PRCE	8:05	11:55	1.6	368.0	100	37.5	47.8	0.0500	0.0073	0.0500			
1161-180614-ASB-JS-05	Felix Valentin, Cleaning Dining Room	PRCE	13:15	15:46	1.5	226.5	100	25.5	32.5	0.0552	0.0119	0.0552			
1161-180614-ASB-JS-06	Jose M Rodriguez, Cleaning Dining Room	PRCE	7:34	11:56	1.6	419.2	100	32	40.8	0.0374	0.0064	0.0374	< 0.0358		
1161-180614-ASB-JS-07	Jose M Rodriguez, Cleaning Dining Room	PRCE	13:16	15:48	1.5	228.0	100	22.5	28.7	0.0484	0.0118	0.0484			
<small>MFC = Measured Fibers Concentration. LOD = Limit of Detection. RFC = Reported Fibers Concentration. T.W.A = Time Weighted Average. PR = Personal T = Type of Sample. BG = Background. EX = Exposure. OS = Outside. PP = Preparation. RM = Removal. CE = Cleaning. CL = Clearance. E = Excursion.</small>															
Reported By: Jose A Santos Environmental Technician jose.santos@altolenterprises.com Phone: 787-507-1627					Signature: 					Verified By: Carlos Ocasio Altol Operation Manager carlos.ocasio@altolenterprises.com Phone: 787-835-4242 / 4229					Signature:
Date: Jun-18-14										Date:					

Customer Name: Homeca Recycling and Demolitions Contact: Melvin Feliciano Phone / Fax/Email: 787-426-1597 Sampling Date: Jun-18-14 Analytical Method: NIOSH 7400 Collected By: Jose A Santos Delivery By: Jose A Santos Received By: Jose A Santos Analyzed By: Jose A Santos Altol Chemical Environmental Laboratory, Inc. Worker Name: Jose M Rodriguez Worker Name: Felix R Valentin Worker Name: Eliceo Caraballo Worker Name: N/A	Project Name: 1 ra Unidad Esc Jorge Lucas Valdiviezo Total Samples: 17 Job Number: ENJ-1161 Custody Record #: Collected ID: ASB-0912-0558-MS Delivery Date: Jun-19-14 Received Date: Jun-19-14 AIHA Lab ID: 199763 Worker ID: ASB-0913-0340-AW Worker ID: ASB-1013-0415-AW Worker ID: ASB-1213-0505-AW Worker ID: N/A
---	---

Project Description: Cleaning Dining Room and Room # 4

Date: Jun-18-14						Date:							
Sample ID	Location	Type	TIME		FLOW RATE (LPM)	SAMPLE VOLUME (Liters)	TOTAL FIELDS COUNTED	TOTAL FIBERS COUNTED	FIBER DENSITY (f/mm2)	M.F.C (f/cc)	L.O.D (f/cc)	R.F.C (f/cc)	T.W.A 8hrs (f/cc)
			START	STOP									
1161-180614-ASB-JS-08	Eliceo Caraballo, Cleaning Room # 4	PRCE	7:40	12:02	1.6	419.2	100	13.5	17.2	0.0158	0.0064	0.0158	< 0.0086
1161-180614-ASB-JS-09	Eliceo Caraballo, Cleaning Room # 4	PRCE	13:32	15:57	1.4	203.0	100	9.5	12.1	0.0230	0.0133	0.0230	
1161-180614-ASB-JS-10	Inside Area (Dining Room)	CE	7:35	11:57	2.5	655.0	100	23	29.3	0.0172	0.0041	0.0172	
1161-180614-ASB-JS-11	Inside Area (Dining Room)	CE	13:18	15:49	2.3	347.3	100	18.5	23.6	0.0261	0.0078	0.0261	
1161-180614-ASB-JS-12	Inside Area (Room # 4)	CE	7:41	12:03	2.5	655.0	100	14.5	18.5	0.0109	0.0041	0.0109	
1161-180614-ASB-JS-13	Inside Area (Room # 4)	CE	13:34	15:58	2.4	345.6	100	16.5	21.0	0.0234	0.0078	0.0234	
1161-180614-ASB-JS-14	Outside Area (Decon, Dining Room)	OS	7:36	11:58	2.5	655.0	100	7.5	9.6	0.0056	0.0041	0.0056	

MFC = Measured Fibers Concentration. LOD = Limit of Detection. RFC = Reported Fibers Concentration. T.W.A = Time Weighted Average. PR = Personal
 T = Type of Sample. BG = Background. EX = Exposure. OS = Outside. PP = Preparation. RM = Removal. CE = Cleaning. CL = Clearance. E = Excursion.

Reported By: Jose A Santos Environmental Technician jose.santos@altolenterprises.com Phone: 787-507-1627	Signature: 	Verified By: Carlos Ocasio Altol Operation Manager carlos.ocasio@altolenterprises.com Phone: 787-835-4242 / 4229	Signature:
Date: Jun-18-14		Date:	



ALTOL ENVIRONMENTAL SERVICES, INC.

PO BOX 359 MERCEDITA, PR 00715-0359

FINAL DAILY PCM AIR MONITORING REPORT FOR FIELD ANALYSIS



Customer Name: Homeca Recycling and Demolitions	Project Name: 1 ra Unidad Esc Jorge Lucas Valdiviezo
Contact: Melvin Feliciano	Total Samples: 17 Job Number: ENJ-1161
Phone / Fax/Email: 787-426-1597	Custody Record #:
Sampling Date: Jun-18-14 Analytical Method: NIOSH 7400	Collected ID: ASB-0912-0558-MS
Collected By: Jose A Santos	Delivery Date: Jun-19-14
Delivery By: Jose A Santos	Received Date: Jun-19-14
Received By: Jose A Santos	AIHA Lab ID: 199763
Analyzed By: Jose A Santos Altol Chemical Environmental Laboratory, Inc.	Worker ID: ASB-0913-0340-AW
Worker Name: Jose M Rodriguez	Worker ID: ASB-1013-0415-AW
Worker Name: Felix R Valentin	Worker ID: ASB-1213-0505-AW
Worker Name: Eliceo Caraballo	Worker ID: N/A
Worker Name: N/A	

Project Description: Cleaning Dining Room and Room # 4

Sample ID	Location	Type	TIME		FLOW RATE (LPM)	SAMPLE VOLUME (Liters)	TOTAL FIELDS COUNTED	TOTAL FIBERS COUNTED	FIBER DENSITY (f/mm2)	M.F.C (f/cc)	L.O.D (f/cc)	R.F.C (f/cc)	T.W.A 8hrs (f/cc)
			START	STOP									
1161-180614-ASB-JS-15	Outside Area (Decon, Dining Room)	OS	13:20	15:50	2.4	360.0	100	14	17.8	0.0191	0.0075	0.0191	
1161-180614-ASB-JS-16	Outside Area (Decon Room # 4)	OS	7:42	12:04	2.5	655.0	100	6.5	8.3	0.0049	0.0041	0.0049	
1161-180614-ASB-JS-17	Outside Area (Decon Room # 4)	OS	13:35	15:59	2.4	345.6	100	9.5	12.1	0.0135	0.0078	0.0135	

MFC = Measured Fibers Concentration. LOD = Limit of Detection. RFC = Reported Fibers Concentration. T.W.A = Time Weighted Average. PR = Personal T= Type of Sample. BG = Background. EX = Exposure. OS = Outside. PP = Preparation. RM = Removal. CE = Cleaning. CL= Clearance. E = Excursion.

Reported By: Jose A Santos Environmental Technician jose.santos@altolenterprises.com Phone: 787-507-1627	Signature: 	Verified By: Carlos Ocasio Altol Operation Manager carlos.ocasio@altolenterprises.com Phone: 787-835-4242 / 4229	Signature:
Date:		Date:	

Customer Name: Homeca Recycling and Demolitions					Project Name: 1 ra Unidad Esc Jorge Lucas Valdiviezo									
Contact: Melvin Feliciano					Total Samples: 15					Job Number: ENJ-1161				
Phone / Fax/Email: 787-426-1597					Worker Name: Ederick J Caquias					Worker ID: ASB-0813-0297-AS				
Collected By: Jose A Santos ASB-0912-0558-MS					Worker Name: Emmanuel Ramos					Worker ID: ASB-0913-0335-AW				
Analized By Lab: Altol Chemical Environmental Laboratory, Inc.					Worker Name: Luis N Ortiz					Worker ID: ASB-0414-0117-AW				
AIHA Lab ID: 199763					Worker Name: N/A					Worker ID: N/A				
Project Description: Cleaning Dining Room and Boys Bathroom in Floor 2 .														

Lab ID	Date	Sample ID	Sample Description	Pump	Time		Flow Rate			Volume (L)	Asbestos		Lead Air	Minutes	SAMPLE TYPE
					START	STOP	Initial	Final	Avg.		PCM	TEM			
JS19061401	Jun-19-14	1161-190614-ASB-JS-01	Field Blank I	-----	----	----	----	----	----	---	X			---	FB
JS19061402	Jun-19-14	1161-190614-ASB-JS-02	Field Blank II	-----	----	----	----	----	----	---	X			---	FB
JS19061403	Jun-19-14	1161-190614-ASB-JS-03	Emmanuel Ramos, Cleaning Dining Room	LV-5089	7:38	8:09	1.6	1.6	1.6	49.6	X			31	E
JS19061404	Jun-19-14	1161-190614-ASB-JS-04	Emmanuel Ramos, Cleaning Dining Room	LV-5089	8:10	11:55	1.6	1.6	1.6	360.0	X			225	PRCE
JS19061405	Jun-19-14	1161-190614-ASB-JS-05	Emmanuel Ramos, Cleaning Dining Room	LV-5089	13:20	15:46	1.6	1.5	1.5	219.0	X			146	PRCE
JS19061406	Jun-19-14	1161-190614-ASB-JS-06	Luis N Ortiz, Cleaning Dining Room	LV-2022	7:39	11:56	1.6	1.6	1.6	411.2	X			257	PRCE
JS19061407	Jun-19-14	1161-190614-ASB-JS-07	Luis N Ortiz, Cleaning Dining Room	LV-2022	13:21	15:48	1.6	1.5	1.5	220.5	X			147	PRCE
JS19061408	Jun-19-14	1161-190614-ASB-JS-08	Ederick J Caquias, Cleaning Boys Bathroom	LV-2046	7:43	12:02	1.6	1.6	1.6	414.4	X			259	PRCE
JS19061409	Jun-19-14	1161-190614-ASB-JS-09	Ederick J Caquias, Bag Out	LV-2046	13:25	13:59	1.6	1.4	1.4	47.6	X			34	PRCE

Turn Around Time: Normal: 7 days X Rush: 24 hours _____ Rush: 16 hours _____

Sampling Collected by:	Relinquished by:	Received by:	Relinquished by:	Received by:	Delivery to Lab by:	Received at Lab by:
Jose A Santos						Jose A Santos
Date: Jun-19-14	Date: Time:	Date: Time:	Date: Time:	Date: Time:	Date: Time:	Date: Time:
						Jun-19-14

Customer Name: Homeca Recycling and Demolitions Contact: Melvin Feliciano Phone / Fax/Email: 787-426-1597 Collected By: Jose A Santos ASB-0912-0558-MS Analyzed By Lab: Altol Chemical Environmental Laboratory, Inc. AIHA Lab ID: 199763	Project Name: 1 ra Unidad Esc Jorge Lucas Valdiviezo Total Samples: 15 Job Number: ENJ-1161 Worker Name: Ederick J Caquias Worker ID: ASB-0813-0297-AS Worker Name: Emmanuel Ramos Worker ID: ASB-0913-0335-AW Worker Name: Luis N Ortiz Worker ID: ASB-0414-0117-AW Worker Name: N/A Worker ID: N/A
---	--

 Project Description: **Cleaning Dining Room and Boys Bathroom in Floor 2 .**

JS19061410	Jun-19-14	1161-190614-ASB-JS-10	Inside Area (Dining Room)	LV-2019	7:40	11:57	2.5	2.5	2.5	642.5	X			257	CE
JS19061411	Jun-19-14	1161-190614-ASB-JS-11	Inside Area (Dining Room)	LV-2019	13:22	15:49	2.5	2.3	2.3	338.1	X			147	CE
JS19061412	Jun-19-14	1161-190614-ASB-JS-12	Outside (Dining Room Decon)	LV-5087	7:41	11:58	2.5	2.5	2.5	642.5	X			257	OS
JS19061413	Jun-19-14	1161-190614-ASB-JS-13	Outside (Dining Room Decon)	LV-5087	13:23	15:51	2.5	2.4	2.4	355.2	X			148	OS
JS19061414	Jun-19-14	1161-190614-ASB-JS-14	Outside Boys Bathroom (Exterior)	LV-5093	7:44	12:03	2.5	2.5	2.5	647.5	X			259	OS
JS19061415	Jun-19-14	1161-190614-ASB-JS-15	Outside (Dumpster)	LV-5093	13:26	14:01	2.5	2.4	2.4	84.0	X			35	OS

Turn Around Time: Normal: 7 days <u> X </u> Rush: 24 hours _____ Rush: 16 hours _____							
Sampling Collected by:	Relinquished by:	Received by:	Relinquished by:	Received by:	Delivery to Lab by:	Received at Lab by:	
Jose A Santos						Jose A Santos	
Date: Time:	Date: Time:	Date: Time:	Date: Time:	Date: Time:	Date: Time:	Date: Time:	
Jun-19-14						Jun-19-14	



ALTOL ENVIRONMENTAL SERVICES, INC.
PO BOX 359 MERCEDITA, PR 00715-0359
FINAL DAILY PCM AIR MONITORING REPORT FOR FIELD ANALYSIS




Customer Name: Homeca Recycling and Demolitions	Project Name: 1 ra Unidad Esc Jorge Lucas Valdiviezo
Contact: Melvin Feliciano	Total Samples: 15 Job Number: ENJ-1161
Phone / Fax/Email: 787-426-1597	Custody Record #:
Sampling Date: Jun-19-14 Analytical Method: NIOSH 7400	Collected ID: ASB-0912-0558-MS
Collected By: Jose A Santos	Delivery Date: Jun-20-14
Delivery By: Jose A Santos	Received Date: Jun-20-14
Received By: Jose A Santos	AIHA Lab ID: 199763
Analyzed By: Jose A Santos Altol Chemical Environmental Laboratory, Inc.	Worker ID: ASB-0813-0297-AS
Worker Name: Ederick J Caquias	Worker ID: ASB-0913-0335-AW
Worker Name: Emmanuel Ramos	Worker ID: ASB-0414-0117-AW
Worker Name: Luis N Ortiz	Worker ID: N/A
Worker Name: N/A	

Project Description: Cleaning Dining Room and Boys Bathroom in Floor 2 .

Sample ID	Location	Type	TIME		FLOW RATE (LPM)	SAMPLE VOLUME (Liters)	TOTAL FIELDS COUNTED	TOTAL FIBERS COUNTED	FIBER DENSITY (f/mm2)	M.F.C (f/cc)	L.O.D (f/cc)	R.F.C (f/cc)	T.W.A 8hrs (f/cc)
			START	STOP									
1161-190614- ASB-JS-01	Field Blank I	FB	----	----	----	---	100	0	0.0	----	----	----	
1161-190614- ASB-JS-02	Field Blank II	FB	----	----	----	---	100	0	0.0	----	----	----	
1161-190614- ASB-JS-03	Emmanuel Ramos, Cleaning Dining Room	E	7:38	8:09	1.6	49.6	100	14.5	18.5	0.1434	0.0544	0.1434	< 0.0651
1161-190614- ASB-JS-04	Emmanuel Ramos, Cleaning Dining Room	PRCE	8:10	11:55	1.6	360.0	100	39.5	50.3	0.0538	0.0075	0.0538	
1161-190614- ASB-JS-05	Emmanuel Ramos, Cleaning Dining Room	PRCE	13:20	15:46	1.5	219.0	100	45	57.3	0.1008	0.0123	0.1008	
1161-190614- ASB-JS-06	Luis N Ortiz, Cleaning Dining Room	PRCE	7:39	11:56	1.6	411.2	100	43.5	55.4	0.0519	0.0066	0.0519	< 0.0526
1161-190614- ASB-JS-07	Luis N Ortiz, Cleaning Dining Room	PRCE	13:21	15:48	1.5	220.5	100	36.5	46.5	0.0812	0.0122	0.0812	

MFC = Measured Fibers Concentration. LOD = Limit of Detection. RFC = Reported Fibers Concentration. T.W.A = Time Weighted Average. PR = Personal
T = Type of Sample. BG = Background. EX = Exposure. OS = Outside. PP = Preparation. RM = Removal. CE = Cleaning. CL = Clearance. E = Excursion.

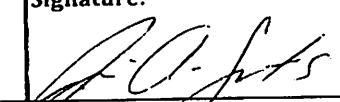
Reported By: Jose A Santos Environmental Technician jose.santos@altolenterprises.com Phone: 787-507-1627	Signature: 	Verified By: Carlos Ocasio Altol Operation Manager carlos.ocasio@altolenterprises.com Phone: 787-835-4242 / 4229	Signature:
--	---	--	-------------------

Customer Name: Homeca Recycling and Demolitions Contact: Melvin Feliciano Phone / Fax/Email: 787-426-1597 Sampling Date: Jun-19-14 Analytical Method: NIOSH 7400 Collected By: Jose A Santos Delivery By: Jose A Santos Received By: Jose A Santos Analyzed By: Jose A Santos Altol Chemical Environmental Laboratory, Inc. Worker Name: Ederick J Caquias Worker Name: Emmanuel Ramos Worker Name: Luis N Ortiz Worker Name: N/A	Project Name: 1 ra Unidad Esc Jorge Lucas Valdiviezo Total Samples: 15 Job Number: ENJ-1161 Custody Record #: Collected ID: ASB-0912-0558-MS Delivery Date: Jun-20-14 Received Date: Jun-20-14 AIHA Lab ID: 199763 Worker ID: ASB-0813-0297-AS Worker ID: ASB-0913-0335-AW Worker ID: ASB-0414-0117-AW Worker ID: N/A
--	---

Project Description: Cleaning Dining Room and Boys Bathroom in Floor 2.

Date: Jun-19-14						Date:							
Sample ID	Location	Type	TIME		FLOW RATE (LPM)	SAMPLE VOLUME (Liters)	TOTAL FIELDS COUNTED	TOTAL FIBERS COUNTED	FIBER DENSITY (f/mm2)	M.F.C (f/cc)	L.O.D (f/cc)	R.F.C (f/cc)	T.W.A 8hrs (f/cc)
			START	STOP									
1161-190614-ASB-JS-08	Ederick J Caquias, Cleaning Boys Bathroom	PRCE	7:43	12:02	1.6	414.4	100	41	52.2	0.0485	0.0065	0.0485	< 0.0262
1161-190614-ASB-JS-09	Ederick J Caquias, Bag Out	PRCE	13:25	13:59	1.4	47.6	100	25.5	32.5	0.2627	0.0567	0.2627	
1161-190614-ASB-JS-10	Inside Area (Dining Room)	CE	7:40	11:57	2.5	642.5	100	32.5	41.4	0.0248	0.0042	0.0248	
1161-190614-ASB-JS-11	Inside Area (Dining Room)	CE	13:22	15:49	2.3	338.1	100	27.5	35.0	0.0399	0.0080	0.0399	
1161-190614-ASB-JS-12	Outside (Dining Room Decon)	OS	7:41	11:58	2.5	642.5	100	12	15.3	0.0092	0.0042	0.0092	
1161-190614-ASB-JS-13	Outside (Dining Room Decon)	OS	13:23	15:51	2.4	355.2	100	9	11.5	0.0124	0.0076	0.0124	
1161-190614-ASB-JS-14	Outside Boys Bathroom (Exterior)	OS	7:44	12:03	2.5	647.5	100	30	38.2	0.0227	0.0042	0.0227	

MFC = Measured Fibers Concentration. LOD = Limit of Detection. RFC = Reported Fibers Concentration. T.W.A = Time Weighted Average. PR = Personal
 T = Type of Sample. BG = Background. EX = Exposure. OS = Outside. PP = Preparation. RM = Removal. CE = Cleaning. CL = Clearance. E = Excursion.

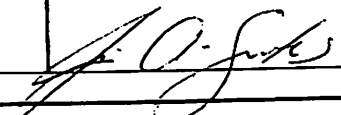Reported By: Jose A Santos Environmental Technician jose.santos@altolenterprises.com Phone: 787-507-1627	Signature: 	Verified By: Carlos Ocasio Altol Operation Manager carlos.ocasio@altolenterprises.com Phone: 787-835-4242 / 4229	Signature:
Date: Jun-19-14		Date:	